


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |

Description: *Header - Earth*


Location: *Base of RH 'A' post*

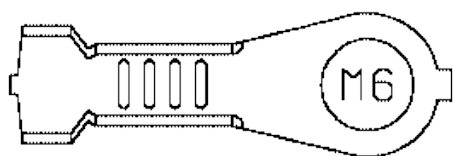

YPG10013


Colour: *TIN-PLATE*

Gender: *Eyelet*

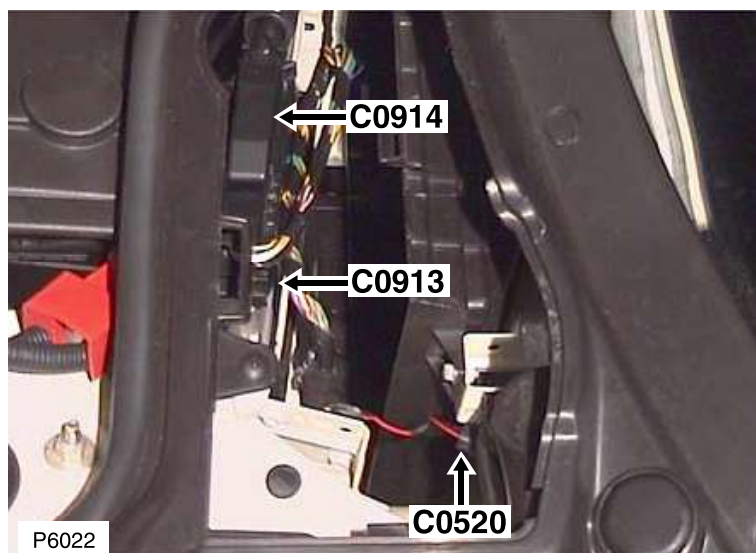

Description: *Engine control module (ECM) - K1.8*

Location: *Beneath passenger side of air intake plenum*

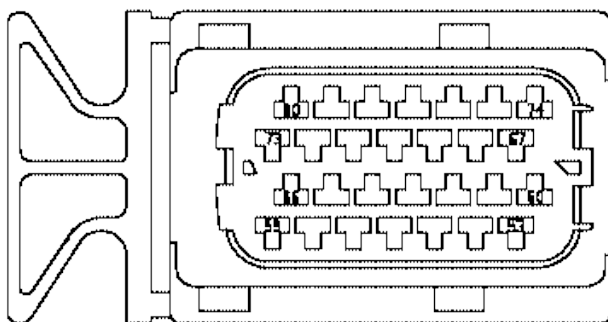


YPC114540

Colour: *BLACK*


Gender: *Female*

| Cav | Col | Cct |
|-----|-----|-----|
| 53  | BR  | 34  |
| 54  | WK  | 34  |
| 56  | SY  | 44  |
| 58  | KW  | 34  |
| 59  | B   | 34  |
| 60  | UR  | 34  |
| 61  | LG  | 34  |
| 64  | RU  | 34  |
| 65  | YB  | ALL |
| 66  | B   | 34  |
| 67  | U   | 34  |
| 68  | BP  | 34  |
| 70  | YS  | 44  |
| 72  | BY  | 34  |
| 73  | B   | 34  |
| 74  | UY  | 44  |
| 79  | YN  | ALL |
| 80  | NK  | 34  |

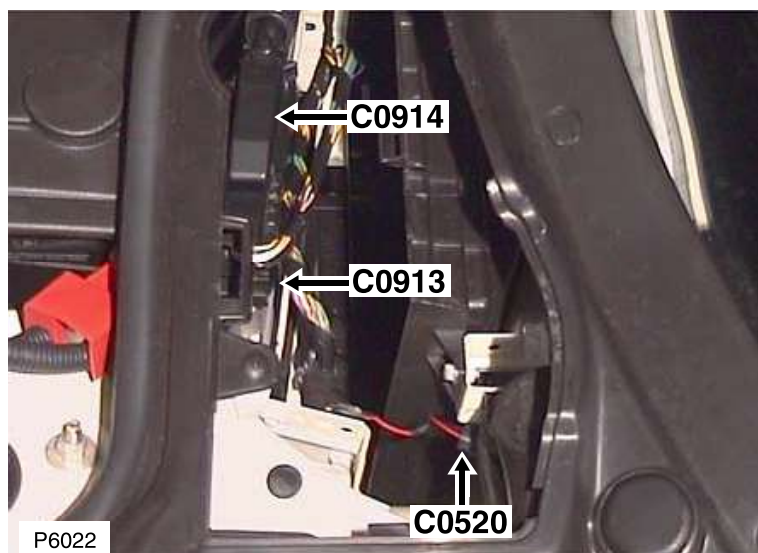

Description: *Engine control module (ECM) - K1.8*

Location: *Beneath passenger side of air intake plenum*

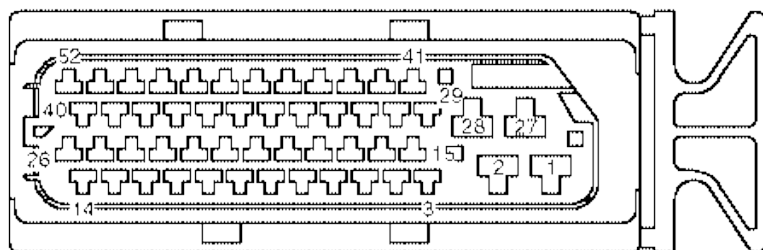

YPC 114550

Colour: *BLACK*

Gender: *Female*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | BU  | ALL |
| 4   | UP  | ALL |
| 6   | KB  | ALL |
| 7   | KB  | ALL |
| 8   | YP  | ALL |
| 10  | YW  | ALL |
| 13  | KU  | ALL |
| 14  | YR  | ALL |
| 15  | B   | ALL |
| 16  | YP  | ALL |
| 18  | KB  | ALL |
| 19  | NK  | ALL |
| 20  | GY  | ALL |
| 21  | LGU | ALL |
| 23  | RU  | ALL |
| 24  | OU  | ALL |
| 25  | YU  | ALL |
| 26  | WB  | ALL |
| 28  | SCR | ALL |
| 30  | WU  | ALL |
| 31  | KB  | ALL |
| 32  | GO  | ALL |
| 33  | KG  | ALL |
| 34  | KB  | ALL |
| 35  | WR  | ALL |
| 37  | KB  | ALL |
| 38  | BO  | ALL |
| 39  | OS  | ALL |
| 40  | YN  | ALL |
| 41  | Y   | ALL |
| 42  | BS  | ALL |
| 44  | YW  | ALL |
| 45  | RG  | ALL |
| 46  | KP  | ALL |
| 50  | OG  | ALL |
| 51  | YG  | ALL |
| 52  | WO  | ALL |



| Cav | Col | Cct |
|-----|-----|-----|
| 1   | NK  | 4   |
| 2   | B   | 4   |

Description: *Pump - Fuel burning heater (FBH) - M47R*

Location: *Beneath rear of vehicle RH side*

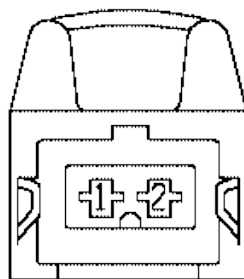


Colour: *BLACK*

Gender: *Female*




# C0921

## CONNECTOR DETAILS

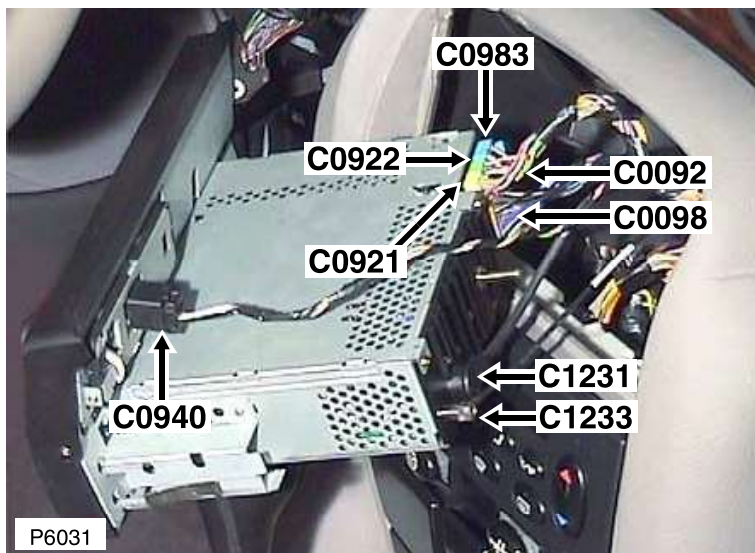


| Cav | Col | Cct |
|-----|-----|-----|
| 2   | PK  | ALL |
| 3   | OS  | ALL |
| 6   | OG  | ALL |

Description: *Radio / cassette player*  
 Location: *Behind radio*

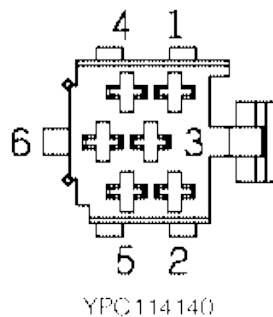


Colour: *YELLOW*  
 Gender: *Female*

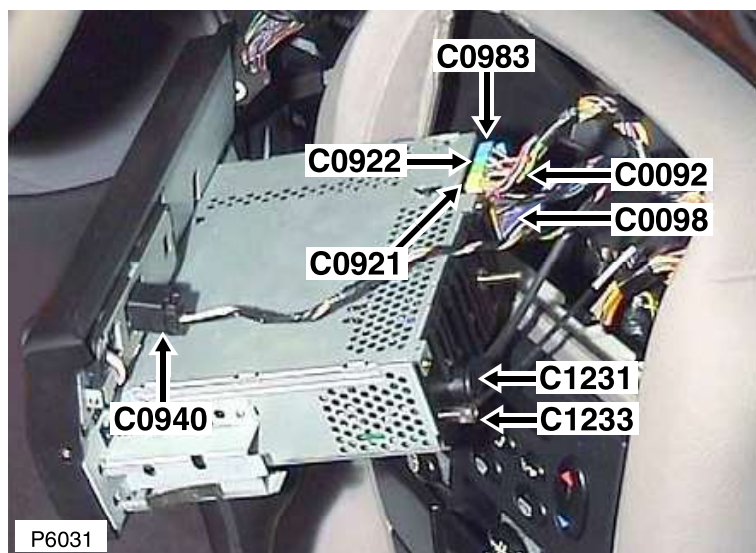

Description: *Radio / cassette player*


Location: *Behind radio*

| Cav | Col | Cct |
|-----|-----|-----|
| 7   | RW  | 8   |
| 8   | PK  | 8   |
| 9   | LGW | 8   |
| 10  | WRY | 8   |
| 11  | B   | 8   |

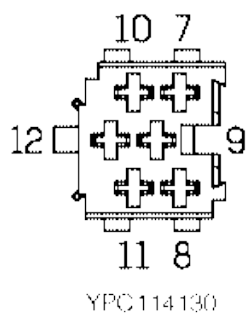


Colour: *GREEN*

Gender: *Female*

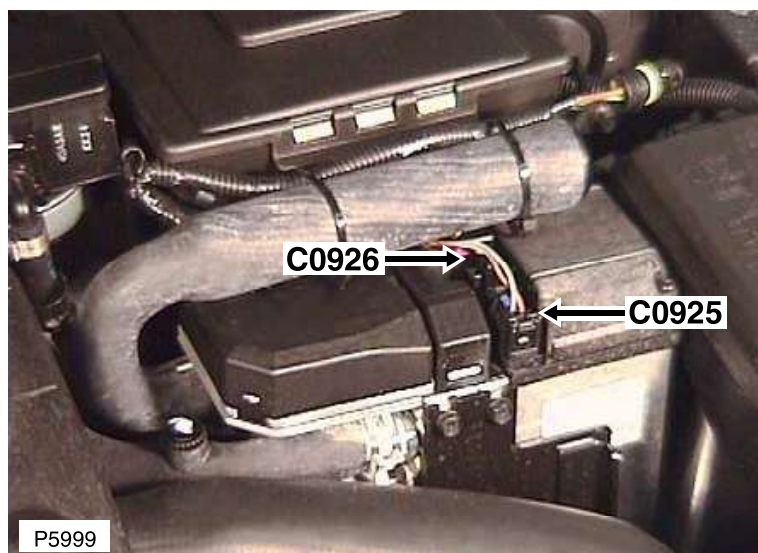

Description: *Heater - Fuel burning - M47R*

Location: *Front LH side of engine compartment*

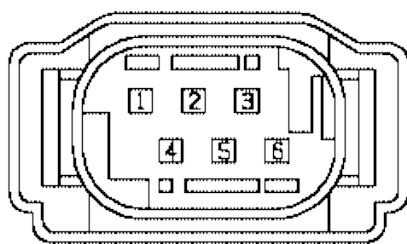


YPC110680

Colour: *BLACK*

Gender: *Female*


| Cav | Col | Cct |
|-----|-----|-----|
| 3   | SG  | 4   |
| 6   | NK  | 4   |

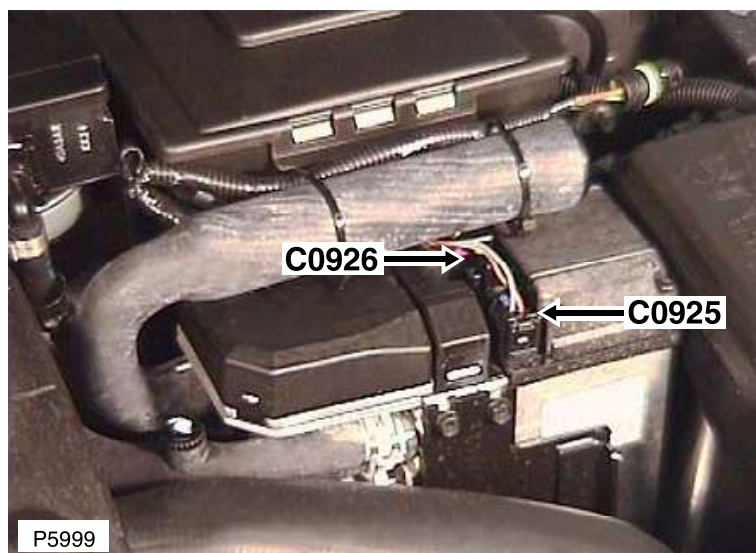

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | OR  | 4   |
| 2   | B   | 4   |

Description: *Heater - Fuel burning - M47R*


Location: *Front LH side of engine compartment*

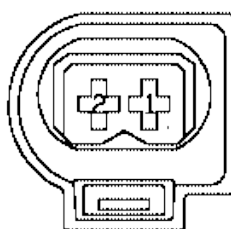

YPC115080

Colour: *BLACK*


Gender: *Female*

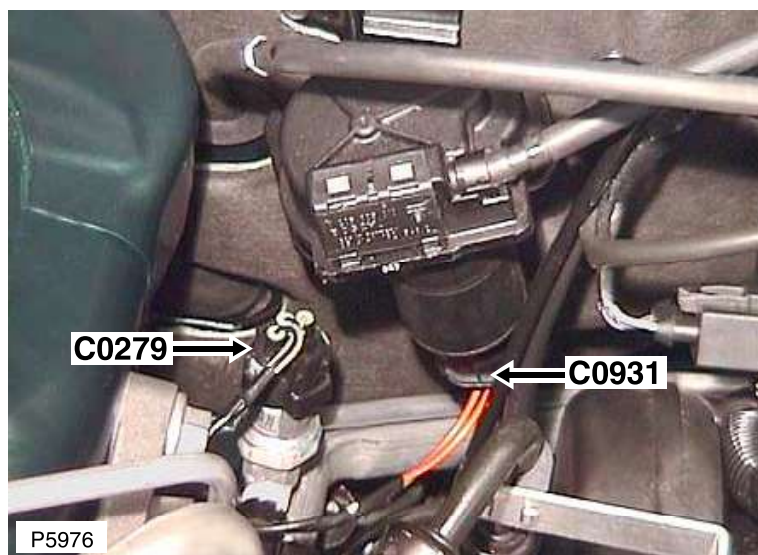

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | RLG | 19  |
| 2   | RO  | 19  |

Description: *Motor - Traction control*


Location: *Rear RH side of engine compartment*

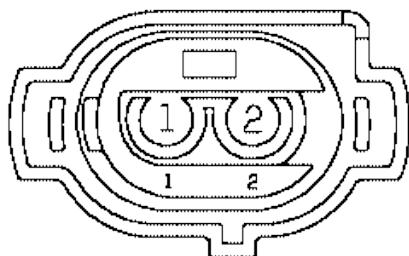

YPC110300


Colour: *BLACK*

Gender: *Female*

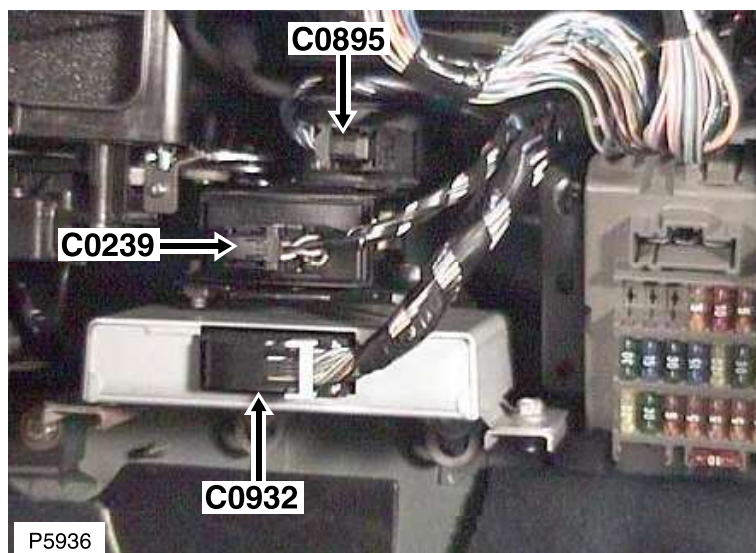

Description: *ECU - Electronic automatic transmission*

Location: *Behind passenger side of fascia*

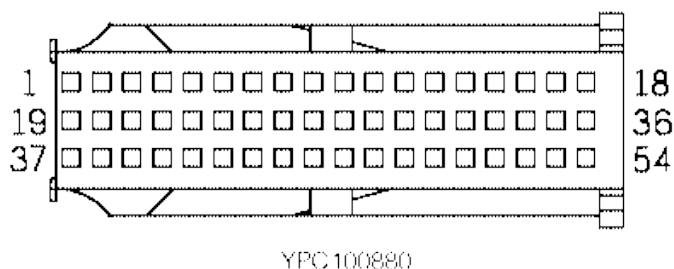

Colour: *BLACK*

Gender: *Female*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | KW  | 10  |
| 3   | SP  | 10  |
| 4   | SG  | 10  |
| 5   | UP  | 10  |
| 7   | GY  | 10  |
| 8   | GS  | 10  |
| 9   | B   | 10  |
| 10  | SU  | 10  |
| 11  | YG  | 36  |
| 12  | YN  | 10  |
| 14  | GW  | 10  |
| 15  | UY  | 10  |
| 16  | WY  | 10  |
| 17  | BN  | 10  |
| 18  | WS  | 10  |
| 20  | B   | 10  |
| 21  | GR  | 10  |
| 24  | GP  | 10  |
| 25  | G   | 10  |
| 26  | LGN | 10  |
| 27  | GB  | 10  |
| 28  | SY  | 10  |
| 30  | GO  | 10  |
| 31  | YO  | 10  |
| 33  | YB  | 10  |
| 36  | YU  | 10  |
| 38  | B   | 10  |
| 39  | UO  | 10  |
| 43  | PG  | 4   |
| 43  | GR  | 7   |
| 45  | GK  | 10  |
| 47  | YB  | 10  |
| 49  | N   | ALL |
| 52  | YR  | 10  |
| 53  | K   | 10  |
| 54  | YU  | 10  |






Description: *ECU - Traction control*  
Location: *Behind passenger side of fascia*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | LGS | 19  |
| 22  | RO  | 19  |
| 24  | PG  | 19  |
| 26  | RLG | 19  |
| 28  | B   | 19  |
| 35  | OG  | 19  |
| 36  | SR  | 19  |
| 37  | OW  | 19  |
| 39  | LGB | 19  |
| 40  | LGU | 19  |
| 42  | LGG | 19  |
| 49  | RO  | 19  |
| 51  | PG  | 19  |
| 53  | RLG | 19  |
| 55  | B   | 19  |



Colour: *BLACK*  
Gender: *Female*




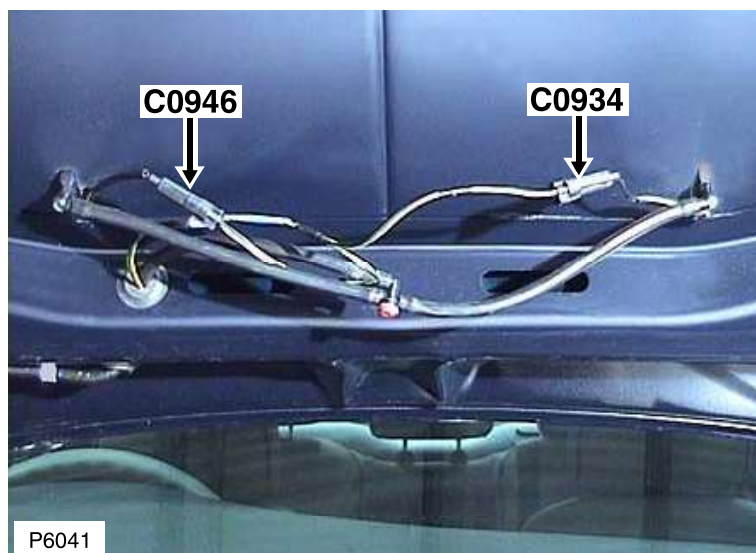

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | LGR | ALL |
| 2   | B   | ALL |

Description: *Washer jet - Heated*

Location: *Underside of bonnet*

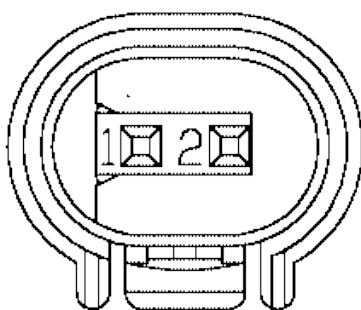


YPC110600

Colour: *LIGHT BLUE*

Gender: *Female*




Description: *Module - Lighting switch*  
Location: *Behind driver side of fascia*

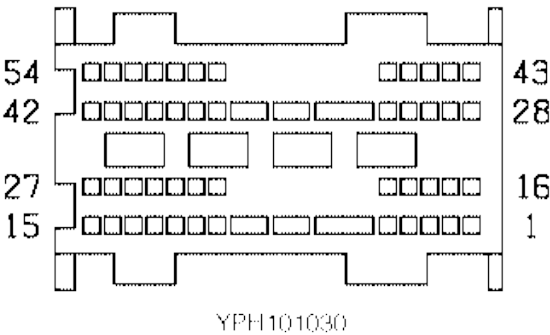

Colour: *BLACK*  
Gender: *Female*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | GK  | ALL |
| 3   | GLG | ALL |
| 5   | LGU | ALL |
| 6   | NO  | ALL |
| 7   | UK  | ALL |
| 8   | UG  | ALL |
| 9   | LG  | ALL |
| 10  | GU  | ALL |
| 11  | GW  | ALL |
| 12  | GY  | ALL |
| 13  | U   | ALL |
| 15  | WG  | ALL |
| 16  | UP  | ALL |
| 17  | RS  | ALL |
| 18  | GO  | ALL |
| 21  | WRY | ALL |
| 24  | LGN | ALL |
| 25  | GP  | ALL |
| 27  | LGP | ALL |
| 28  | WP  | ALL |
| 29  | RU  | ALL |
| 30  | RN  | ALL |
| 31  | B   | ALL |
| 32  | B   | ALL |
| 33  | NLG | ALL |
| 34  | UB  | ALL |
| 35  | US  | ALL |
| 36  | RW  | ALL |
| 39  | KB  | ALL |
| 40  | KN  | ALL |
| 41  | KW  | ALL |
| 42  | KR  | ALL |
| 43  | GS  | ALL |
| 44  | RO  | ALL |
| 45  | RB  | ALL |
| 47  | UW  | ALL |
| 48  | GY  | ALL |


| Cav | Col | Cct |
|-----|-----|-----|
| 49  | UY  | ALL |
| 50  | GR  | ALL |
| 51  | KU  | ALL |
| 52  | KY  | ALL |
| 53  | KG  | ALL |
| 54  | KO  | ALL |

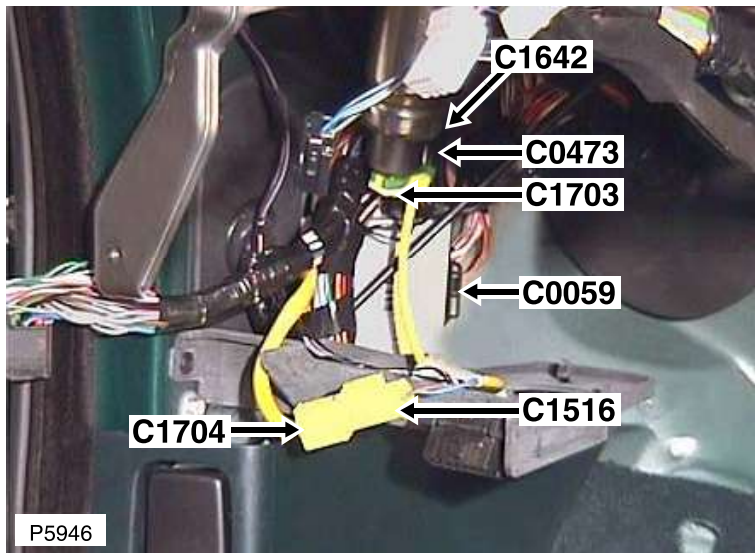

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | WN  | ALL |
| 2   | WK  | ALL |

Description: *Airbag - head*

Location: *Behind LH side of fascia*

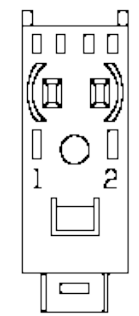

YK0001910

Colour: *GREEN*


Gender: *Female*



| Cav | Col | Cct |
|-----|-----|-----|
| 1   | RN  | ALL |
| 2   | RK  | ALL |

Description: *Airbag - head*

Location: *Behind RH side of fascia*




Y130001910

Colour: *GREEN*


Gender: *Female*

# C0940

## CONNECTOR DETAILS

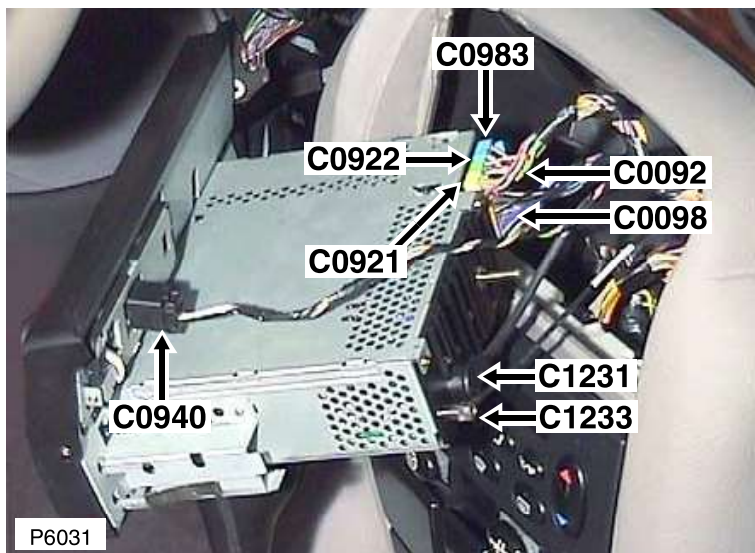


Description: *Switch - Navigation*  
 Location: *Behind radio*

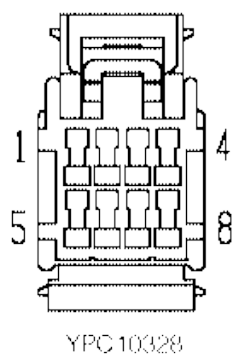


Colour: *BLACK*  
 Gender: *Female*

| Cav | Col | Cct |
|-----|-----|-----|
| 4   | LGW | 8   |
| 5   | RW  | 8   |
| 6   | WRY | 8   |
| 7   | PK  | 8   |
| 8   | B   | 8   |

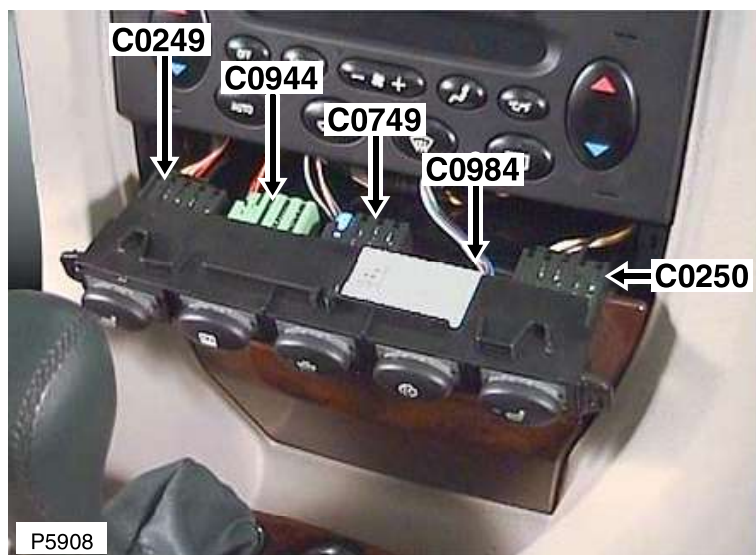


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | LGR | 17  |
| 2   | RW  | 17  |
| 3   | B   | 17  |
| 4   | OB  | 17  |
| 6   | ON  | 17  |

Description: *Switch - Sun blind*  
Location: *Behind centre console*

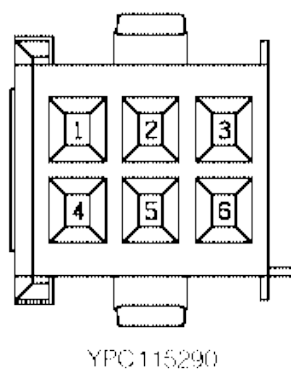


Colour: *BLACK*  
Gender: *Female*



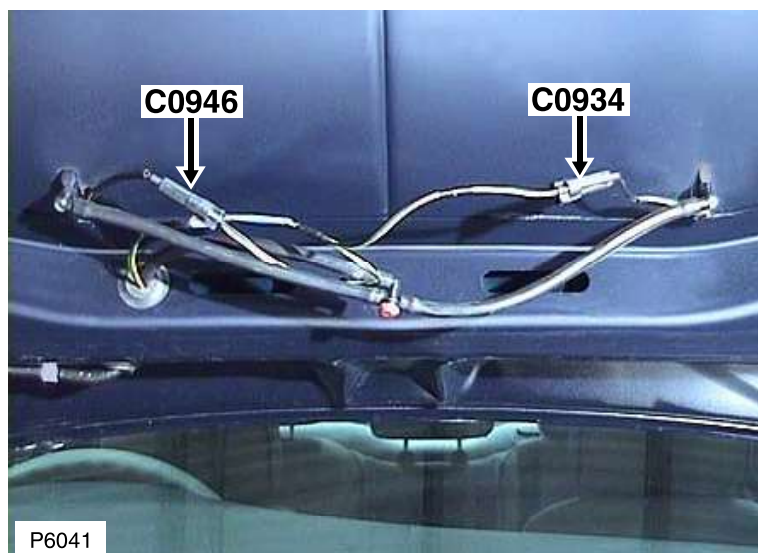


Description: *Washer jet - Heated*  
Location: *Underside of bonnet*

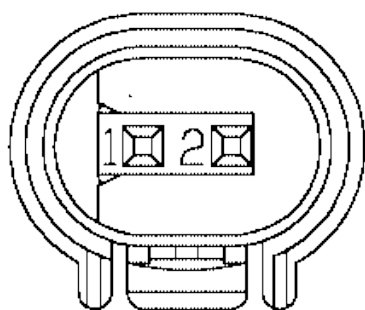

YPC110600

Colour: *LIGHT BLUE*  
Gender: *Female*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | LGR | ALL |
| 2   | B   | ALL |

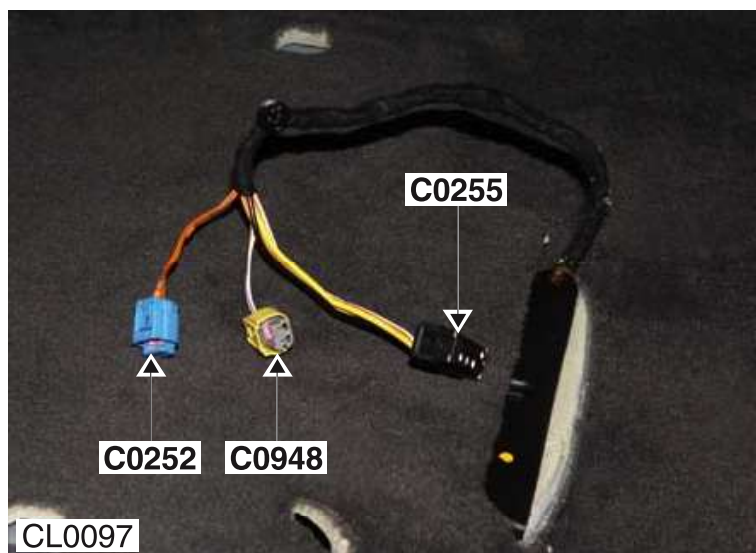

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | WO  | 65  |
| 2   | WP  | 65  |

Description: *Airbag - Side - LH - RHD*

Location: *Beneath front passenger's seat*


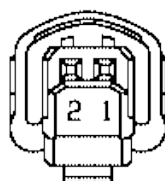


FIGURE 9


Colour: *YELLOW*

Gender: *Female*

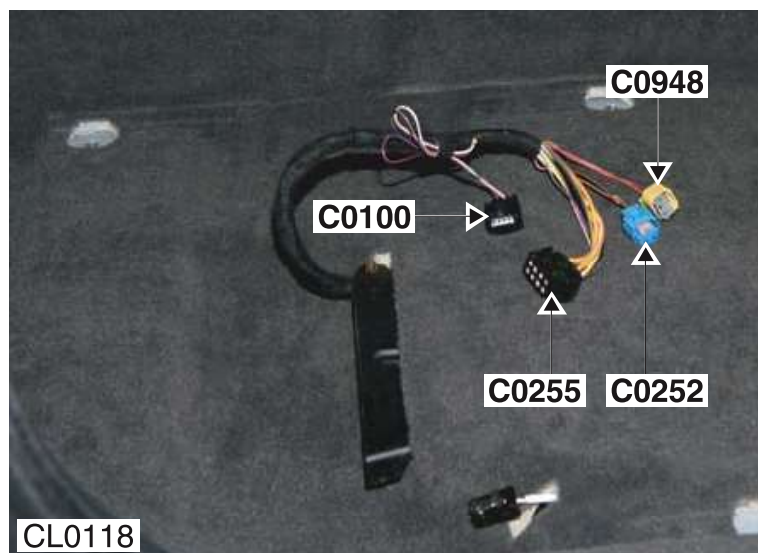


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | WO  | 65  |
| 2   | WP  | 65  |

Description: *Airbag - Side - LH - LHD*  
Location: *Beneath driver's seat*

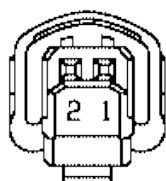

PIN 1

Colour: *YELLOW*  
Gender: *Female*

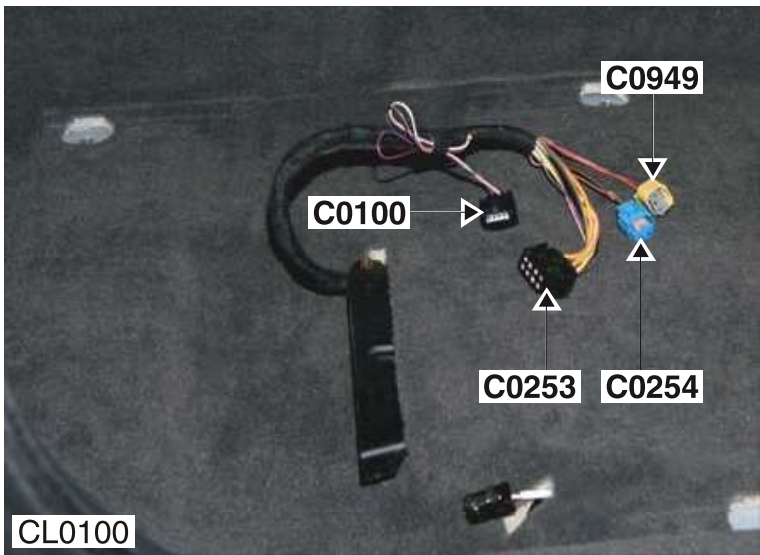

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | RO  | 65  |
| 2   | RP  | 65  |

Description: *Airbag - Side - RH - RHD*  
Location: *Beneath driver's seat*

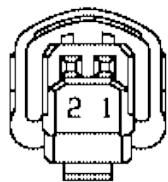


FIGURE 9

Colour: *YELLOW*  
Gender: *Female*


# C0949

## CONNECTOR DETAILS



| Cav | Col | Cct |
|-----|-----|-----|
| 1   | RO  | 65  |
| 2   | RP  | 65  |

Description: *Airbag - Side - RH - LHD*  
 Location: *Beneath front passenger's seat*

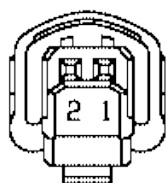

PIN 1


Colour: *YELLOW*  
 Gender: *Female*



| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | 65  |
| 2   | S   | 65  |

Description: *Sensor - Airbag - Side - LH*

Location: *Base of 'B' post LH side*

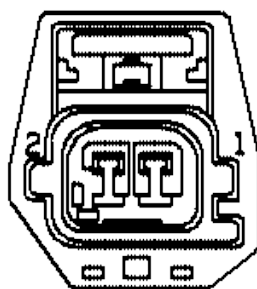


YPC001630

Colour: *BLACK*

Gender: *Female*


# C0951

## CONNECTOR DETAILS

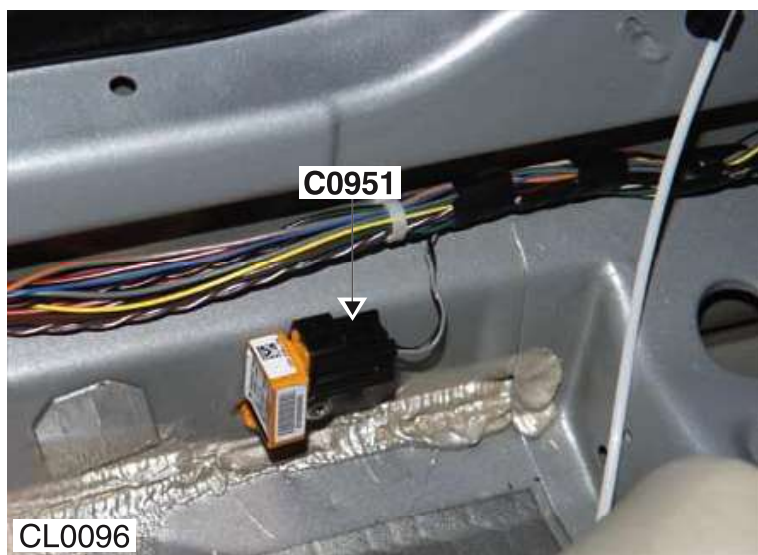

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | 65  |
| 2   | U   | 65  |


Description: *Sensor - Airbag - Side - RH*  
Location: *Base of 'B' post RH side*

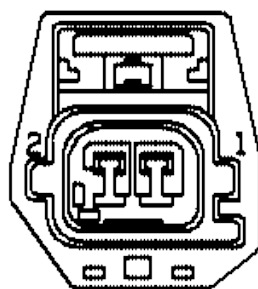

YPC001630

Colour: *BLACK*  
Gender: *Female*




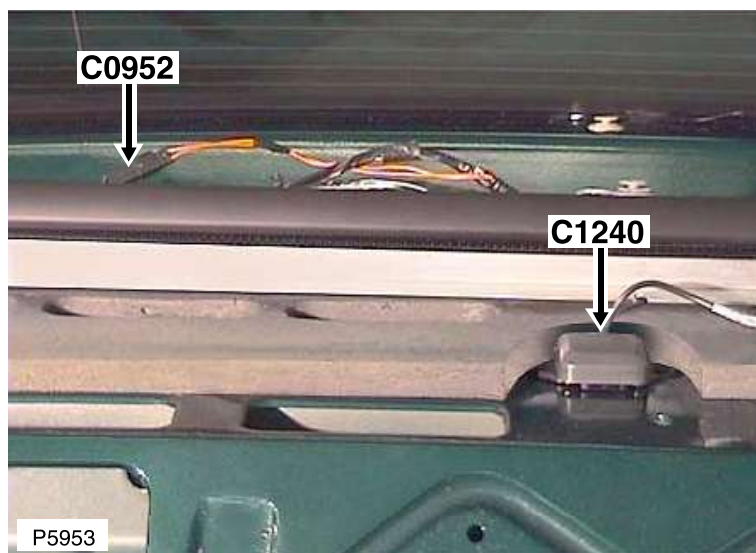

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | OB  | 17  |
| 3   | ON  | 17  |

Description: *Motor - Sun blind*


Location: *Parcel shelf - under right hand side*

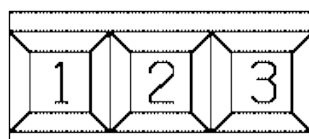

YPC117800

Colour: *BLACK*


Gender: *Female*

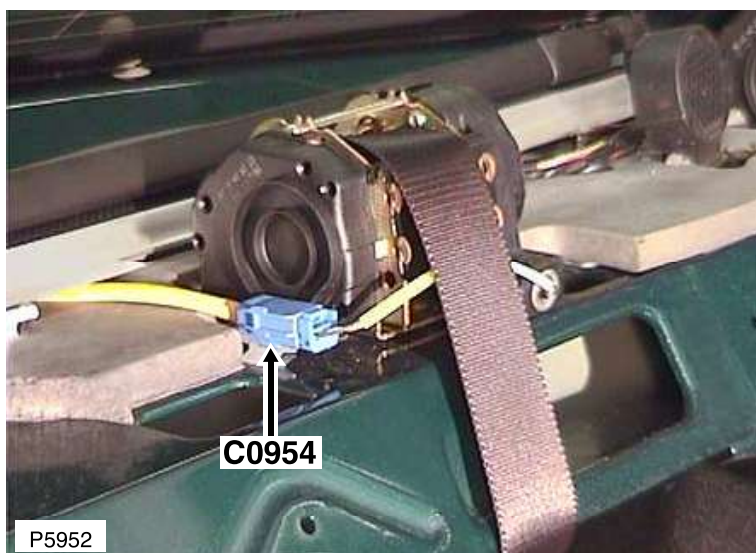

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | NY  | 24  |
| 2   | NK  | 24  |

Description: *Pre-tensioner - Rear - Centre*


Location: *Parcel shelf - under centre*

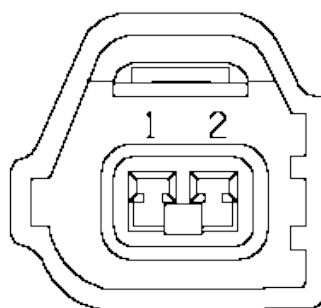

YIRC108820

Colour: *BLUE*


Gender: *Male*

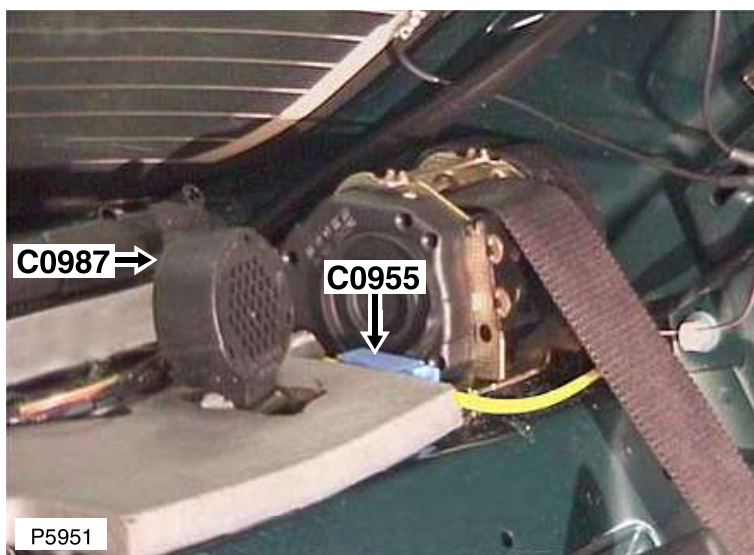

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | OU  | 24  |
| 2   | OW  | 24  |

Description: *Pre-tensioner - Rear - LH - RHD*


Location: *Parcel shelf - under left hand side*

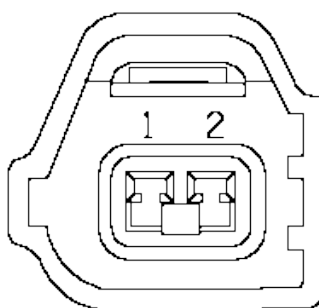

YPC108820


Colour: *BLUE*

Gender: *Male*

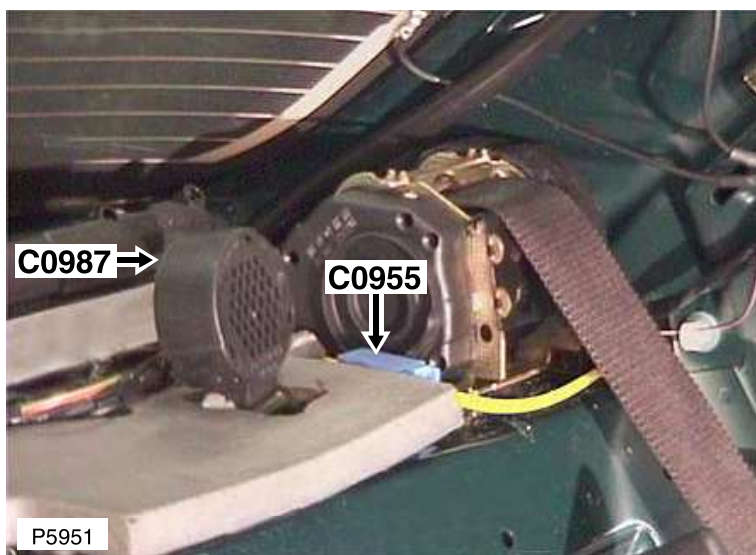

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | NU  | 24  |
| 2   | NW  | 24  |

Description: *Pre-tensioner - Rear - LH - LHD*  
Location: *Parcel shelf - under left hand side*

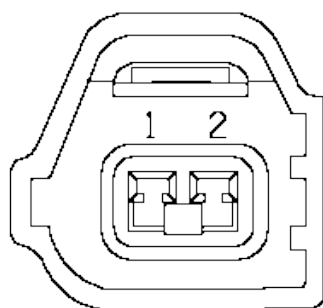

YIRC108820


Colour: *BLUE*  
Gender: *Male*



| Cav | Col | Cct |
|-----|-----|-----|
| 1   | NU  | 24  |
| 2   | NW  | 24  |

Description: *Pre-tensioner - Rear - RH - RHD*


Location: *Parcel shelf - under right hand side*

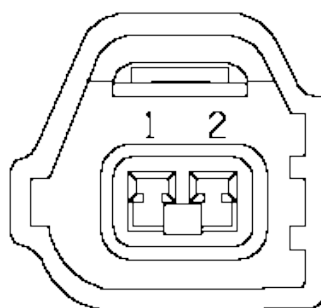

YPC108820

Colour: *BLUE*


Gender: *Male*

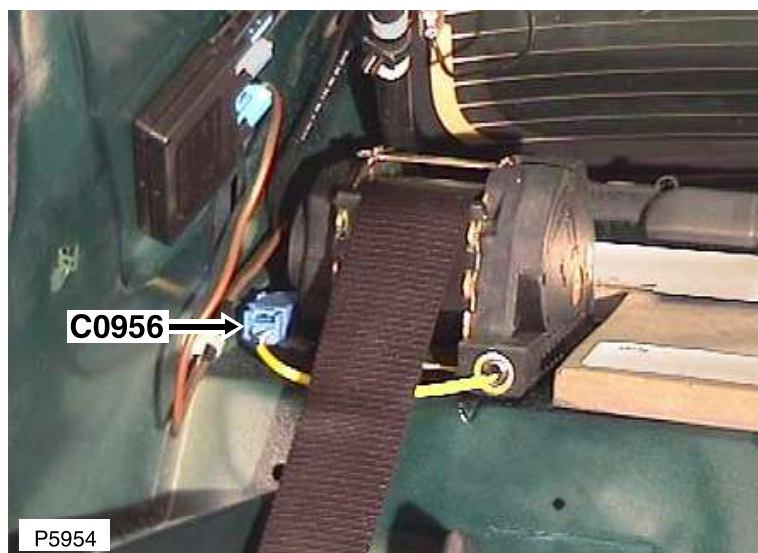

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | OU  | 24  |
| 2   | OW  | 24  |

Description: *Pre-tensioner - Rear - RH - LHD*


Location: *Parcel shelf - under right hand side*

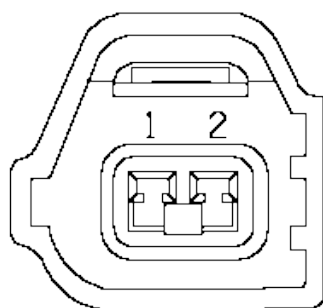

YIRC108820

Colour: *BLUE*


Gender: *Male*

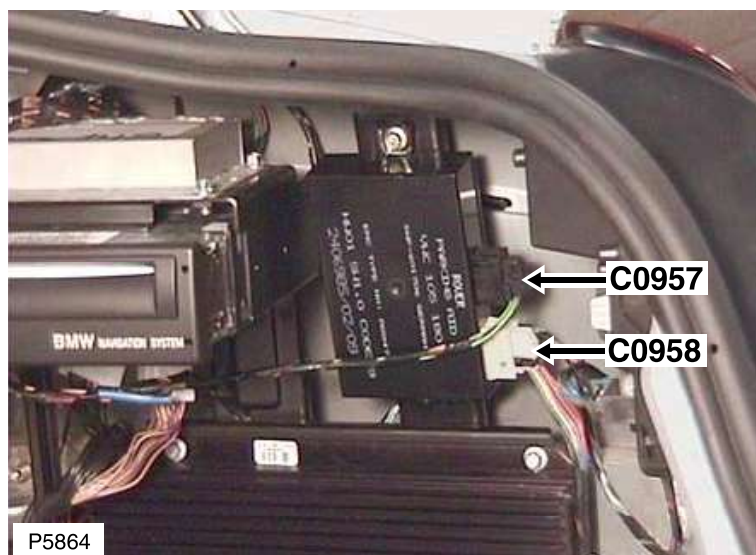

Description: *ECU - Park - Distance control*

Location: *Behind luggage compartment carpet RH side*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | LGR | 25  |
| 2   | RLG | 25  |
| 4   | WRY | 25  |
| 6   | B   | 25  |
| 8   | LGR | 25  |
| 12  | GN  | 25  |

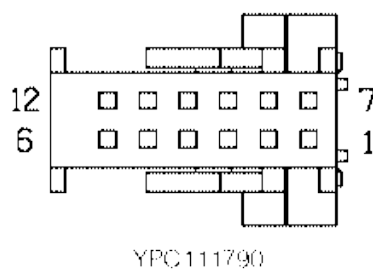

Colour: *BLACK*


Gender: *Female*



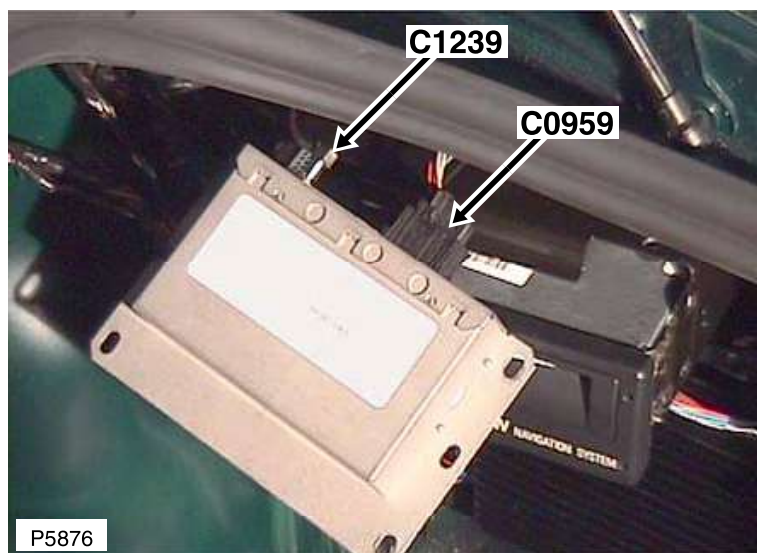

Description: *Reciever - Navigation*


Location: *Behind luggage compartment carpet RH side*

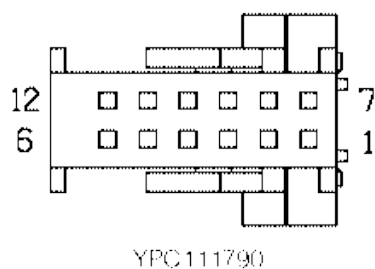

Colour: *BLACK*

Gender: *Female*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | RU  | ALL |
| 3   | RY  | ALL |
| 4   | RW  | ALL |
| 5   | RS  | ALL |
| 6   | SP  | ALL |
| 7   | LGW | ALL |
| 8   | PK  | ALL |

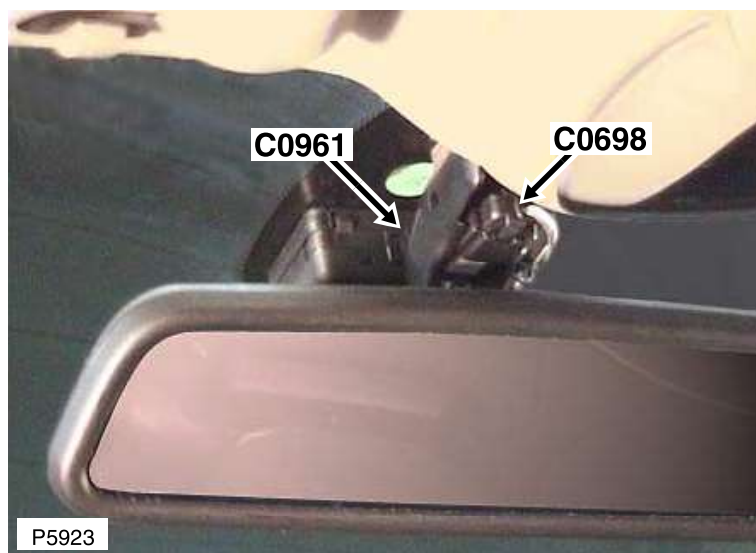

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | WY  | ALL |
| 2   | B   | ALL |
| 3   | K   | ALL |
| 4   | NLG | ALL |

Description: *Sensor - Rain*


Location: *Rear view mirror*

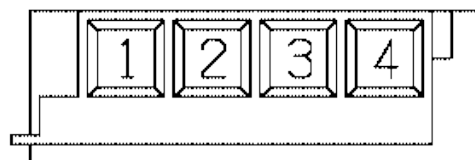

YPC117840

Colour: *BLACK*


Gender: *Female*

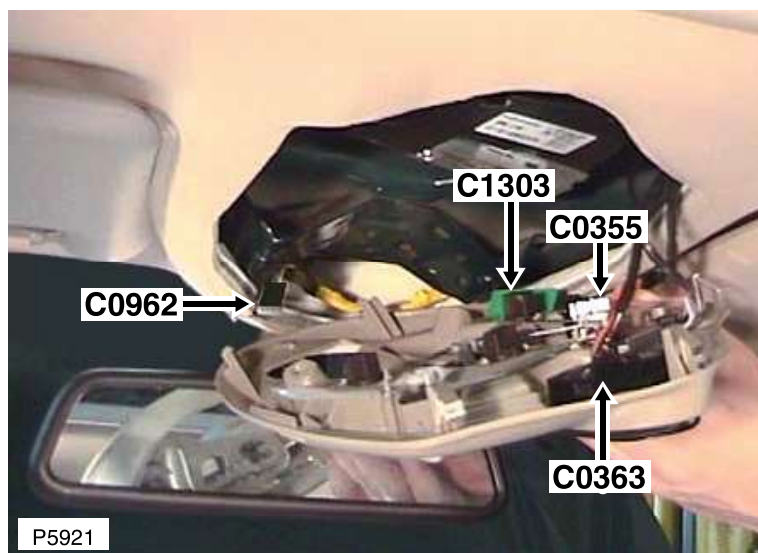

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | 2   |
| 2   | G   | 2   |
| 3   | YU  | 2   |

Description: *Sensor - Occupancy detection*


Location: *Behind interior light*

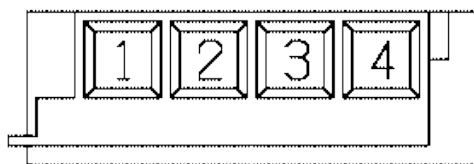

YPC117850

Colour: *WHITE*


Gender: *Female*

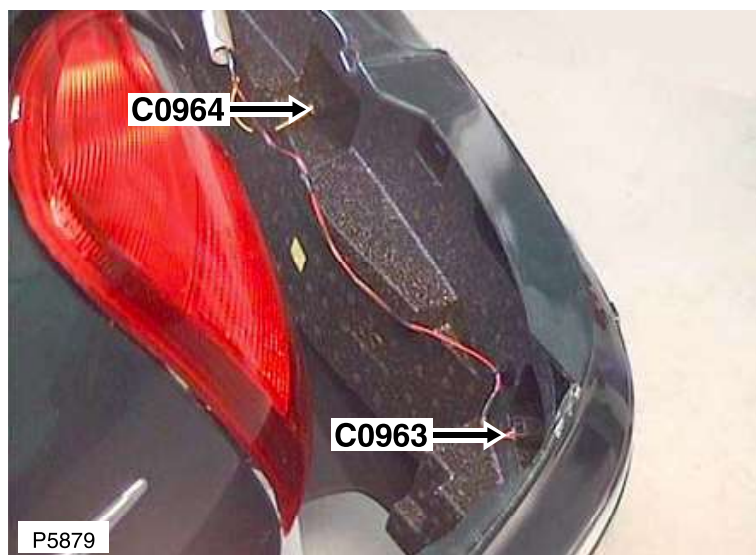

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | N   | ALL |
| 2   | R   | ALL |
| 3   | B   | ALL |

Description: *Sensor - PDC - Outer - Rear - LH*


Location: *Behind LH side of rear bumper*

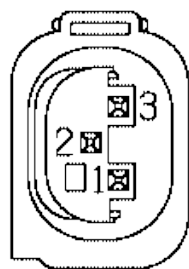

YPC116860


Colour: *GREY*

Gender: *Female*

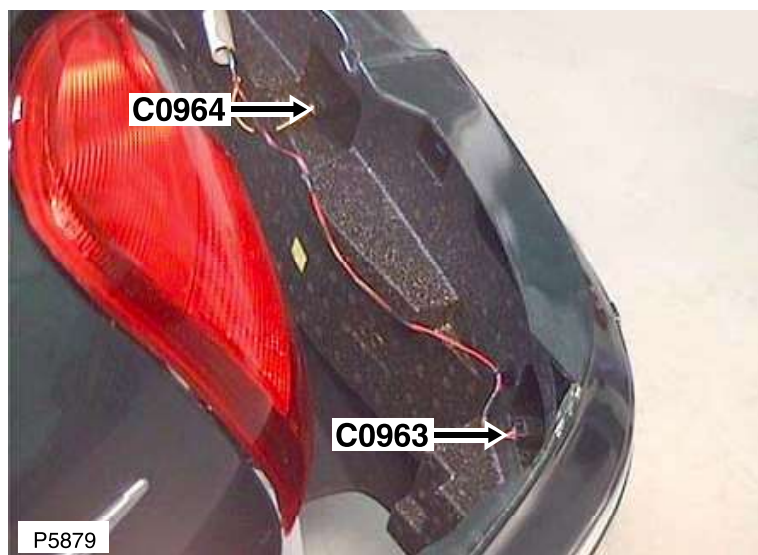

Description: *Sensor - PDC - Inner - Rear - LH*

Location: *Behind LH side of rear bumper*

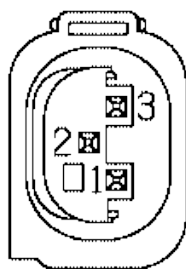

YPC116860

Colour: *GREY*  
Gender: *Female*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | N   | ALL |
| 2   | Y   | ALL |
| 3   | B   | ALL |



Description: *Sensor - PDC - Inner - Rear - RH*

Location: *Behind RH side of rear bumper*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | N   | ALL |
| 2   | G   | ALL |
| 3   | B   | ALL |

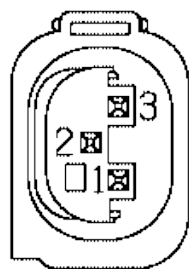

YPC116860

Colour: *GREY*

Gender: *Female*

# C0966


## CONNECTOR DETAILS



Description: *Sensor - PDC - Outer - Rear - RH*

Location: *Behind RH side of rear bumper*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | N   | ALL |
| 2   | U   | ALL |
| 3   | B   | ALL |

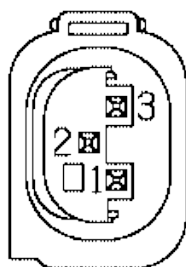

YPC116860

Colour: *GREY*  
Gender: *Female*






| Cav | Col | Cct |
|-----|-----|-----|
| 1   | KS  | ALL |
| 6   | B   | ALL |

Description: *Switch - Boot release*


Location: *Base of driver side 'A' post*

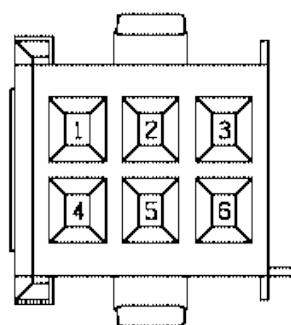

YPC115290

Colour: *BLACK*


Gender: *Female*

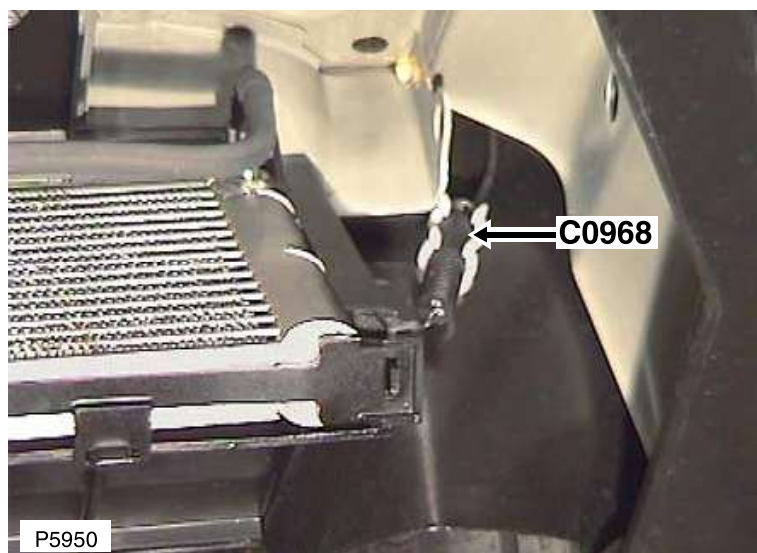

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | BW  | ALL |
| 2   | B   | ALL |

Description: *Sensor - Pad wear*


Location: *Beneath rear of vehicle RH side*

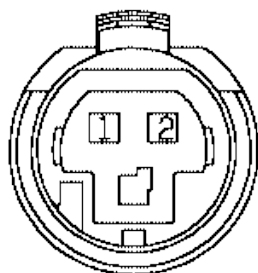

YPC 110480

Colour: *BLACK*


Gender: *Female*

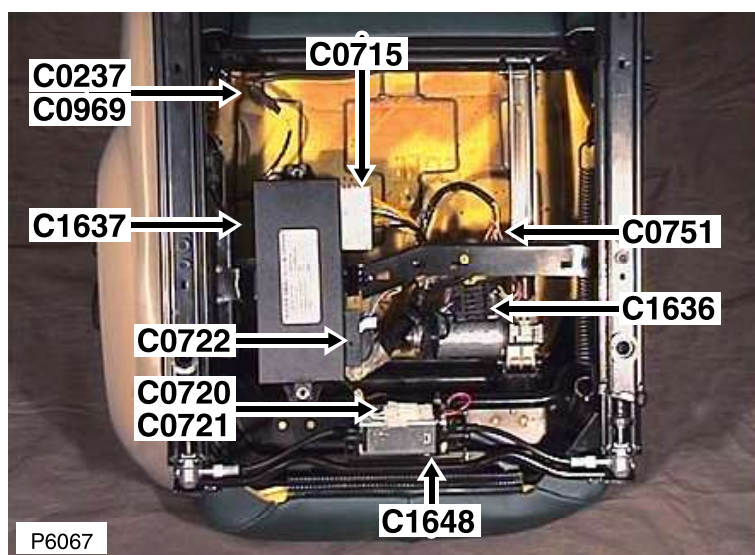

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | Y   | ALL |
| 2   | OW  | ALL |

Description: *Heater - Seat cushion - RH*

Location: *Beneath driver's seat*

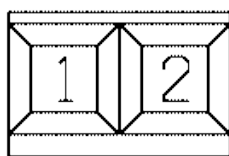

YPC111740


Colour: *BLACK*

Gender: *Female*




| Cav | Col | Cct |
|-----|-----|-----|
| 1   | LGR | 27  |
| 2   | B   | 27  |

Description: *Main harness to heated washer jet harness*  
Location: *Behind RH front wheel arch liner*

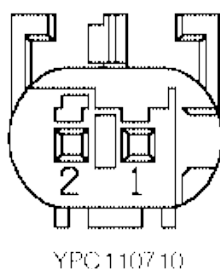


Colour: *BLACK*  
Gender: *Male*

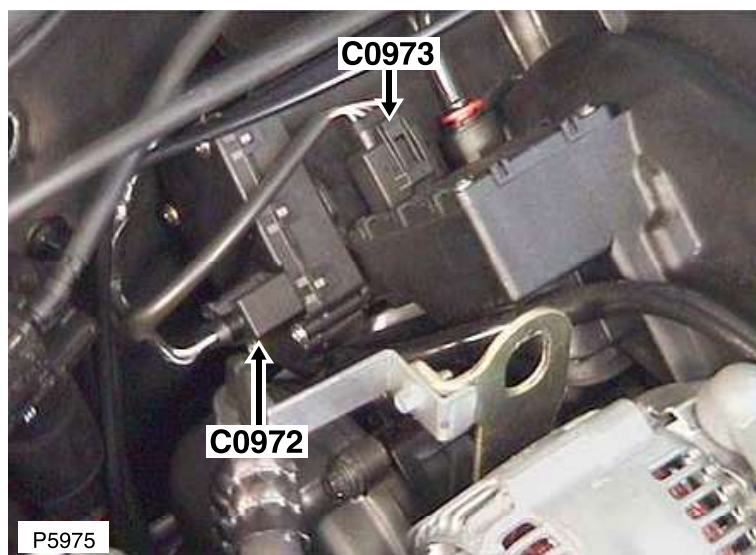

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | SB  | ALL |
| 2   | OU  | ALL |
| 3   | B   | ALL |
| 4   | YU  | ALL |

Description: *Valve - Variable intake solenoid - KV6*


Location: *Top of engine*

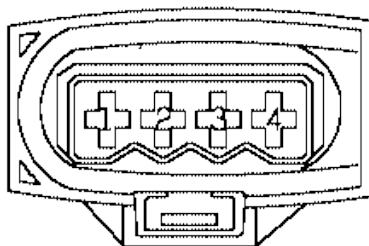

YPC113840


Colour: *BLACK*

Gender: *Female*

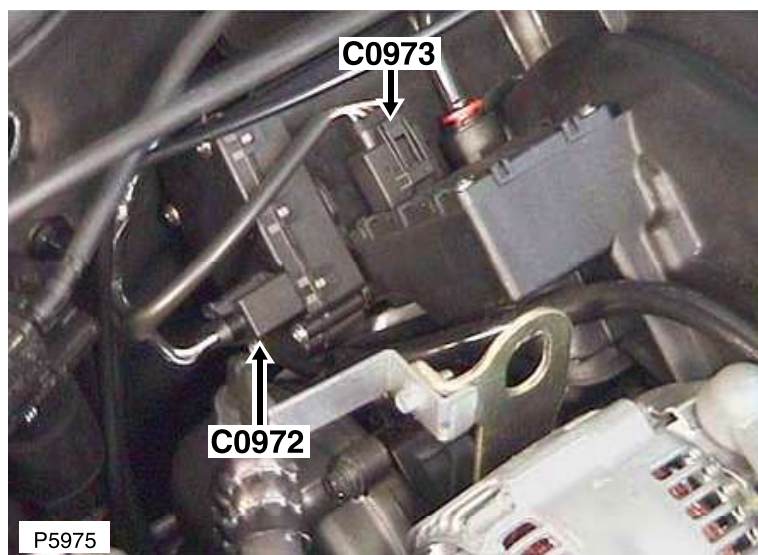

Description: *Valve - Variable intake solenoid - KV6*

Location: *Under RH side of fascia*

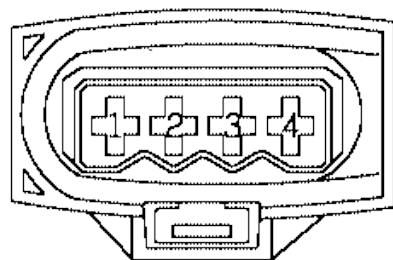


YPC114880

Colour: *BLACK*


Gender: *Female*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | OY  | ALL |
| 2   | B   | ALL |
| 3   | YU  | ALL |
| 4   | UK  | ALL |

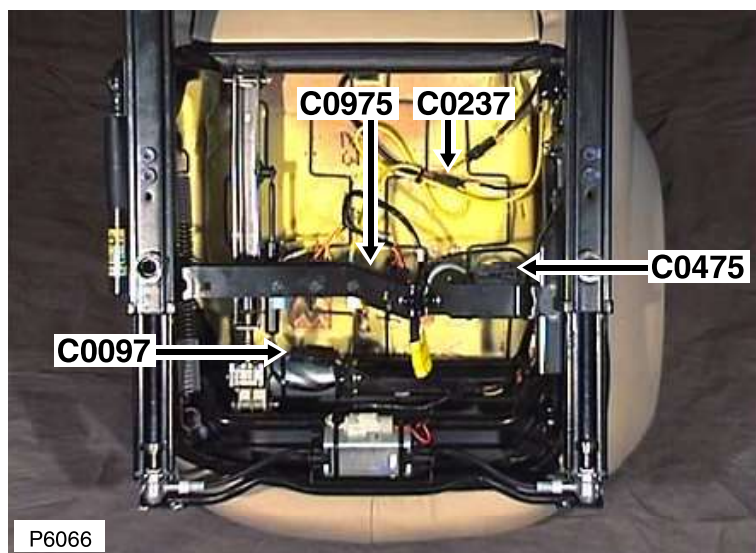

Description: *Relay - Seat*

Location: *Beneath driver's seat*

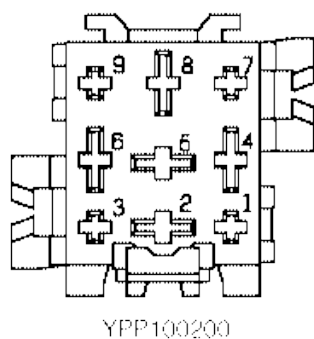

Colour: *BLACK*

Gender: *Female*


| Cav | Col | Cct |
|-----|-----|-----|
| 2   | O   | ALL |
| 4   | B   | ALL |
| 6   | OW  | ALL |
| 8   | OG  | ALL |





Description: *Main harness to radio harness*

Location: *Behind front of centre console*

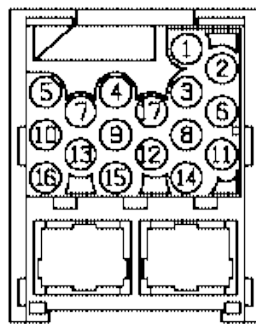


YPC115120

Colour: *BLACK*

Gender: *Female*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | BW  | 23  |
| 2   | BP  | 23  |
| 3   | BN  | 23  |
| 5   | LGW | 23  |
| 6   | BG  | 23  |
| 7   | WRY | 23  |
| 8   | BS  | 23  |
| 9   | PK  | 23  |
| 10  | UO  | 23  |
| 11  | BU  | 23  |
| 12  | BR  | 23  |
| 13  | RW  | 23  |
| 14  | BO  | 23  |
| 15  | B   | 23  |
| 16  | PY  | 23  |
| 17  | UP  | 23  |

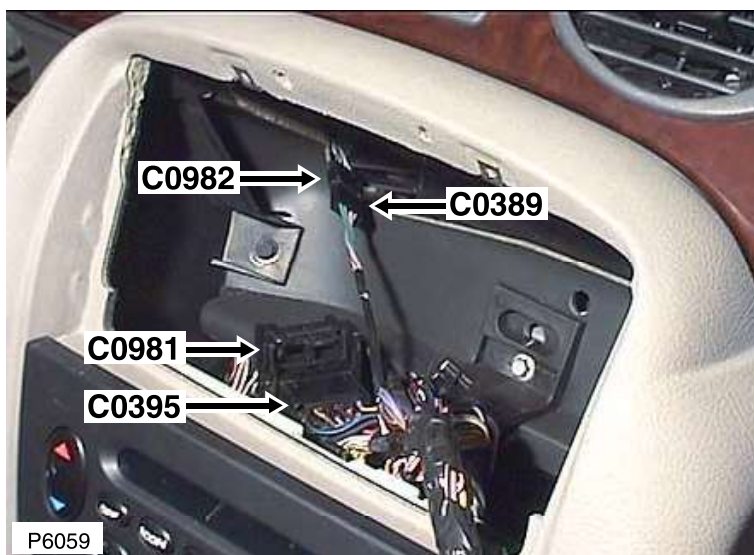

Description: *Main harness to radio harness*

Location: *Behind front of centre console*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | GN  | 8   |
| 2   | SG  | 8   |
| 4   | KB  | 8   |




YPC111760

Colour: *BLACK*

Gender: *Female*


# C0983

## CONNECTOR DETAILS

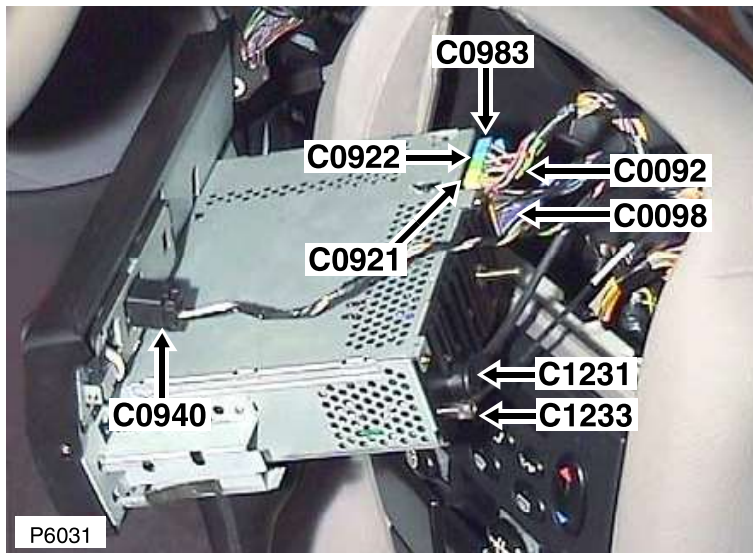


Description: *Radio / cassette player*  
 Location: *Behind radio*

| Cav | Col | Cct |
|-----|-----|-----|
| 13  | KB  | ALL |
| 14  | YB  | ALL |
| 15  | B   | ALL |
| 16  | BK  | ALL |
| 17  | BY  | ALL |
| 19  | WRY | ALL |
| 20  | PK  | ALL |

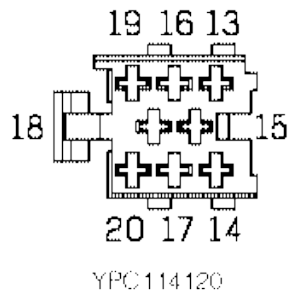


Colour: *BLUE*  
 Gender: *Female*

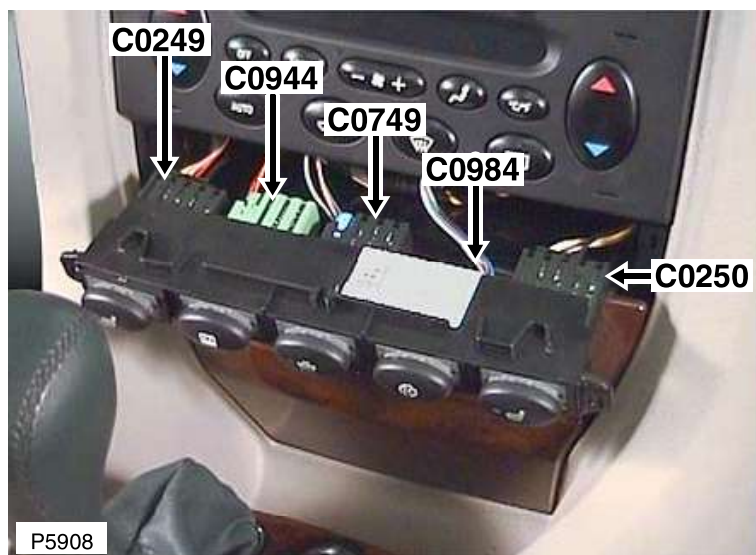

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | SLG | ALL |
| 4   | B   | ALL |
| 5   | RW  | ALL |
| 6   | LGS | ALL |

Description: *Switch - Traction control*


Location: *Behind centre console*

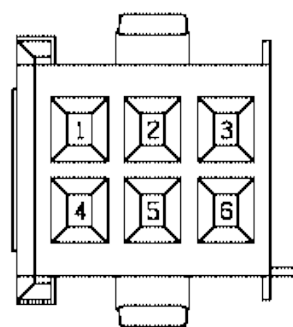

YPC115290

Colour: *BLACK*


Gender: *Female*

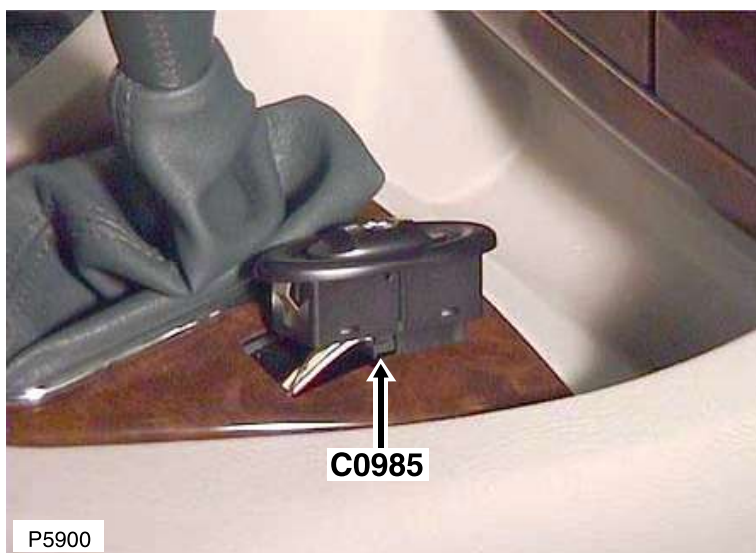

Description: *Switch - Sport/Snow*

Location: *Behind front of centre console*


| Cav | Col | Cct |
|-----|-----|-----|
| 2   | RW  | 10  |
| 3   | SY  | 10  |
| 4   | YB  | 10  |
| 5   | YO  | 10  |
| 6   | B   | 10  |



YPC111760

Colour: *BLACK*


Gender: *Female*

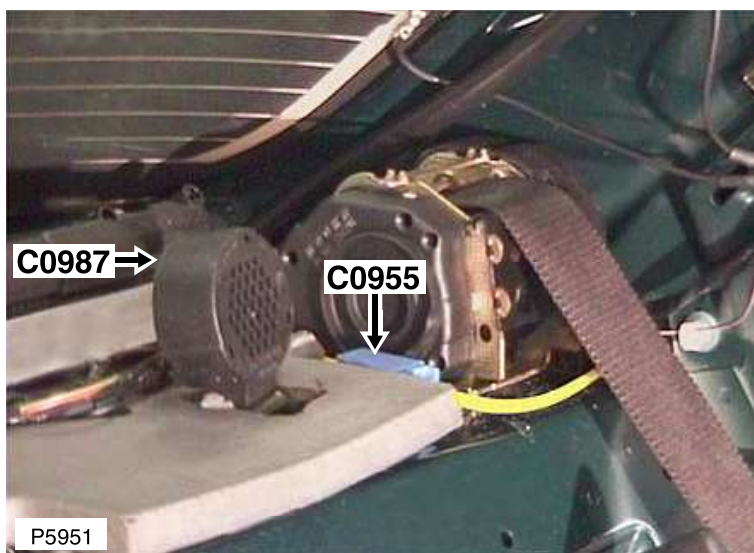

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | LGR | 25  |
| 2   | RLG | 25  |

Description: *Speaker - PDC*

Location: *Parcel shelf - under left hand side*

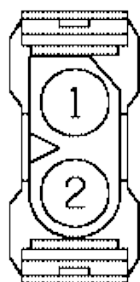


YPC112260

Colour: *BLACK*

Gender: *Female*


# C0991

## CONNECTOR DETAILS

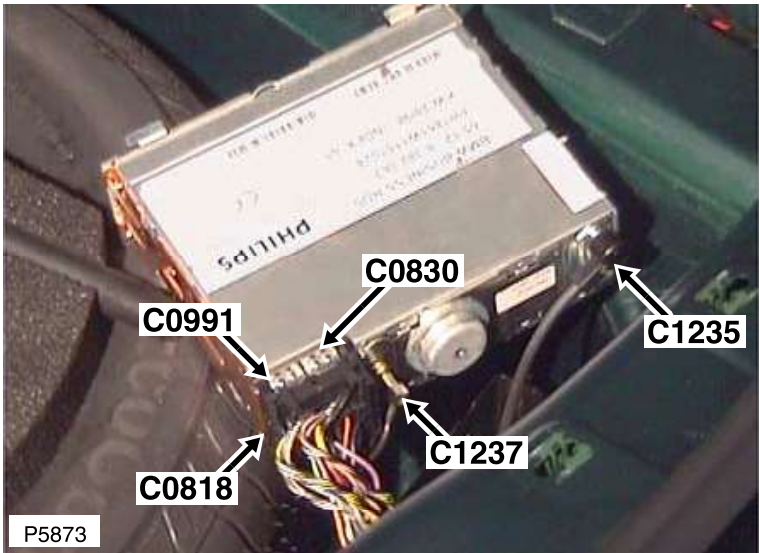


Description: *Radio - Rear*  
Location: *Rear of luggage compartment - RH side*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | YB  | ALL |
| 2   | BY  | ALL |
| 5   | YU  | ALL |
| 6   | KB  | ALL |
| 7   | BK  | ALL |
| 10  | UY  | ALL |

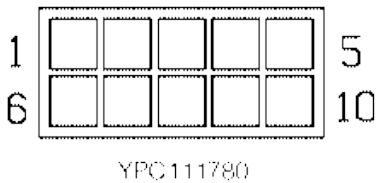

Colour: *BLACK*  
Gender: *Female*




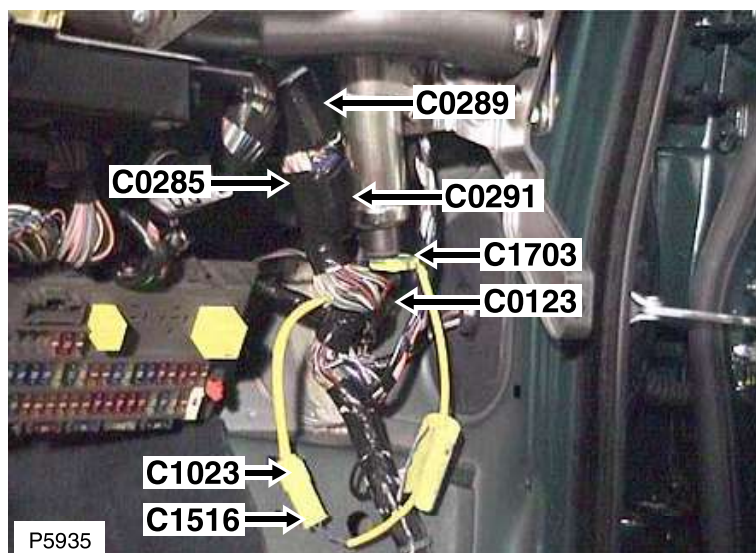

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | RN  | 48  |
| 2   | RK  | 48  |

Description: *Main harness to SRS harness*


Location: *Behind RH side of fascia*

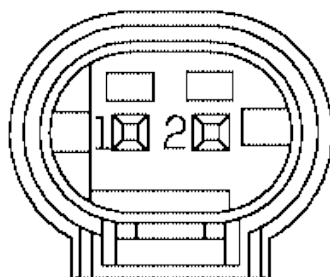

YPC116050


Colour: *YELLOW*

Gender: *Female*

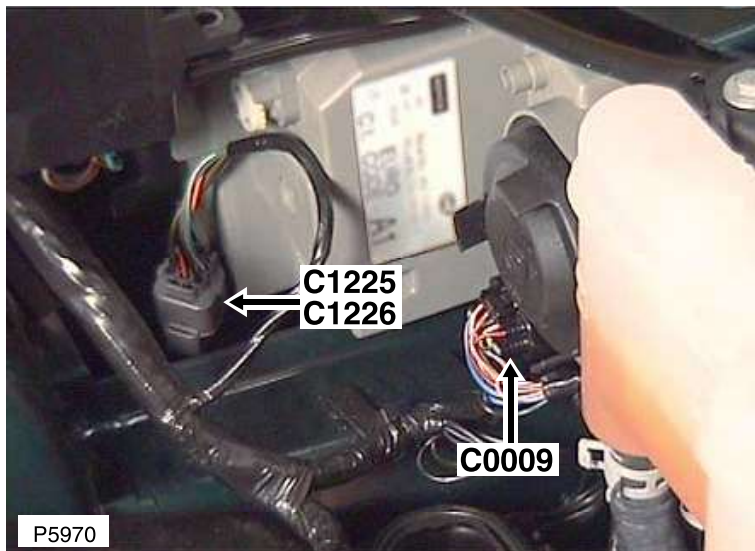

Description: *Main harness to front fog lamp harness*


Location: *Front corner of engine compartment - LH side*

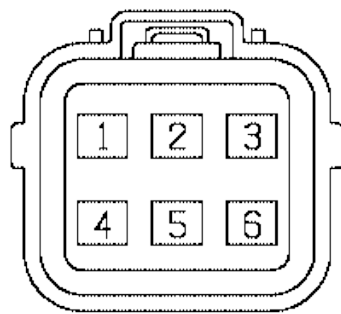

YPC 10542

Colour: *GREY*  
Gender: *Female*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | GW  | ALL |
| 2   | GR  | ALL |
| 3   | NLG | 1   |
| 4   | B   | ALL |
| 5   | O   | ALL |
| 6   | BS  | ALL |

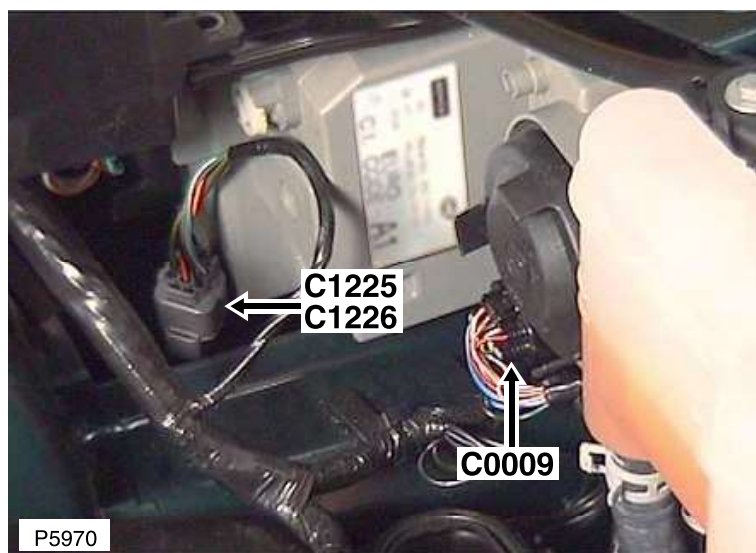

Description: *Front fog lamp harness to main harness*

Location: *Front corner of engine compartment - LH side*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | GW  | ALL |
| 2   | GR  | ALL |
| 3   | NLG | 1   |
| 4   | B   | ALL |
| 5   | O   | ALL |
| 6   | BS  | ALL |

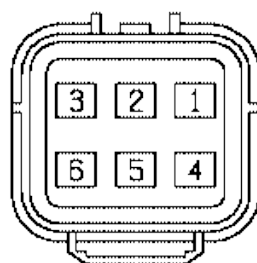

YPC106620


Colour: *GREY*

Gender: *Male*

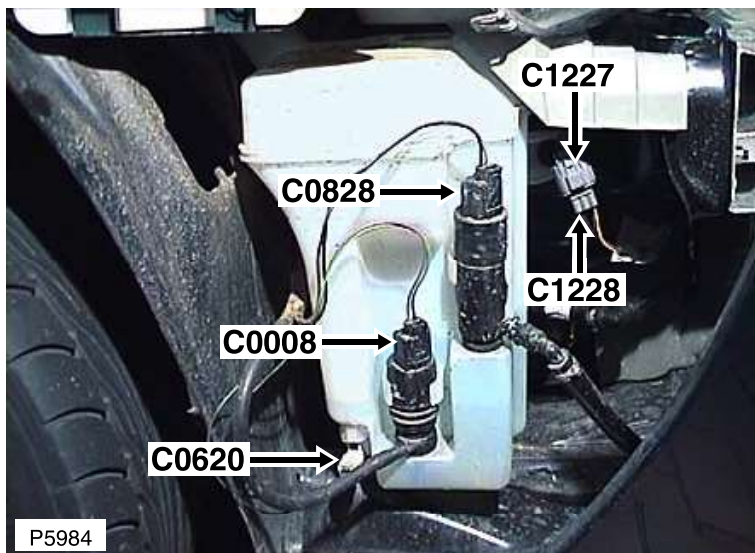


Description: *Main harness to horn harness*  
 Location: *Behind RH side of front bumper*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | SG  | 4   |
| 2   | NY  | 4   |
| 3   | PU  | ALL |
| 4   | B   | ALL |
| 6   | YN  | ALL |

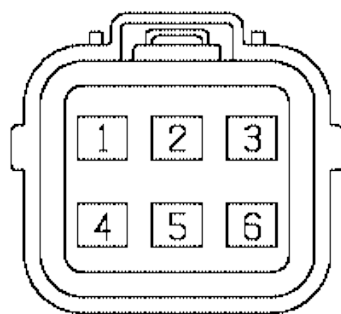


YPC 10542

Colour: *GREY*  
 Gender: *Female*

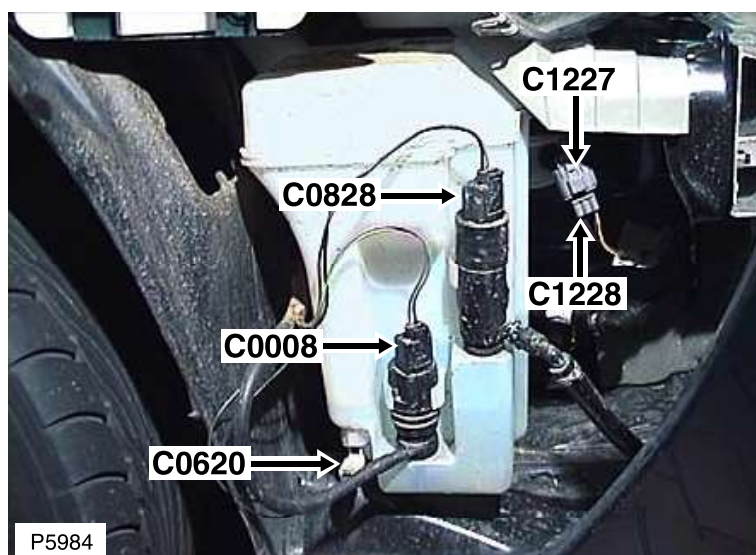

Description: *Horn harness to main harness*

Location: *Behind RH side of front bumper*

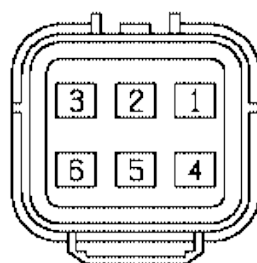


YPC106620

Colour: *GREY*

Gender: *Male*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | SG  | 4   |
| 2   | NY  | 4   |
| 3   | PU  | ALL |
| 4   | B   | ALL |
| 6   | YN  | ALL |

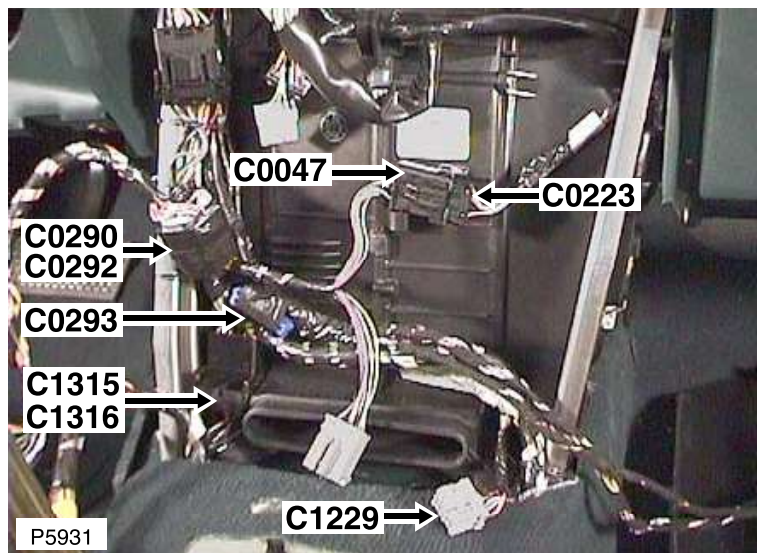

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | RG  | ALL |
| 3   | RW  | ALL |
| 4   | WRY | ALL |
| 5   | LGW | ALL |
| 6   | PK  | ALL |
| 7   | OG  | ALL |
| 8   | OS  | ALL |

Description: *I.C.E. harness to telephone harness*

Location: *Behind front of centre console*

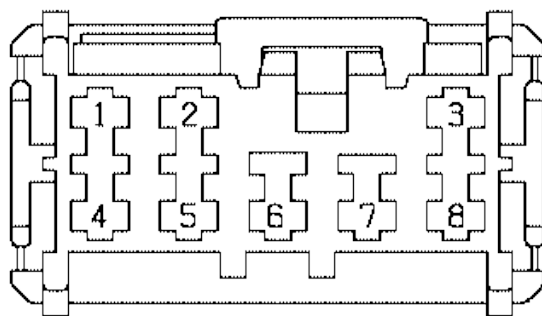


YPC 10492

Colour: *LIGHT GREY*

Gender: *Female*




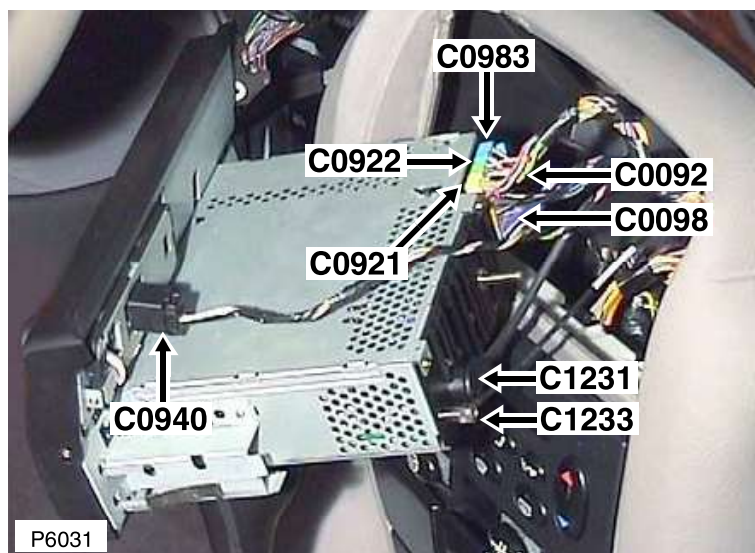

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | 24  |
| 2   | SCR | 24  |

Description: *Co-axial cable*

Location: *Behind radio*

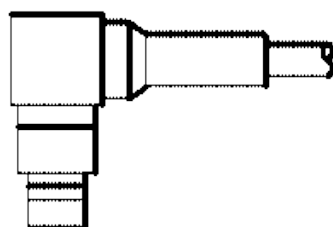

51277143


Colour: *TIN-PLATE*

Gender: *Female*



# C1232


## CONNECTOR DETAILS

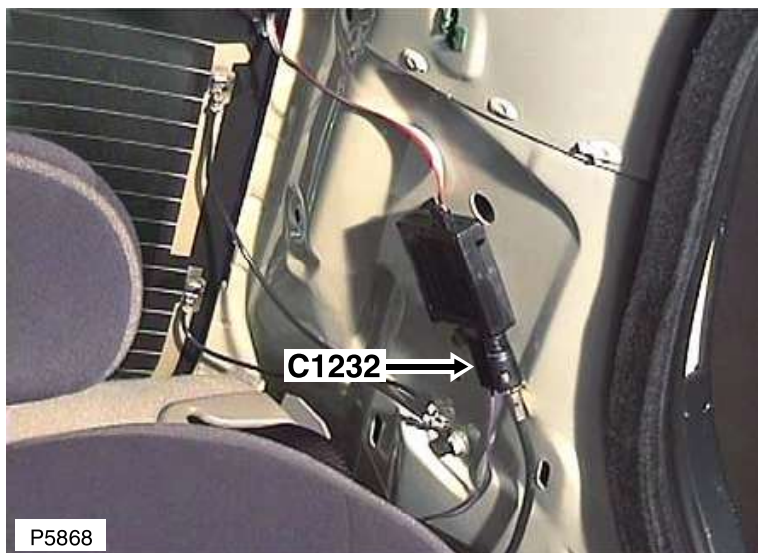

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | 24  |
| 2   | SCR | 24  |

Description: *Co-axial cable*


Location: *LH 'D' post*



0000000000

Colour: *TIN-PLATE*


Gender: *Female*

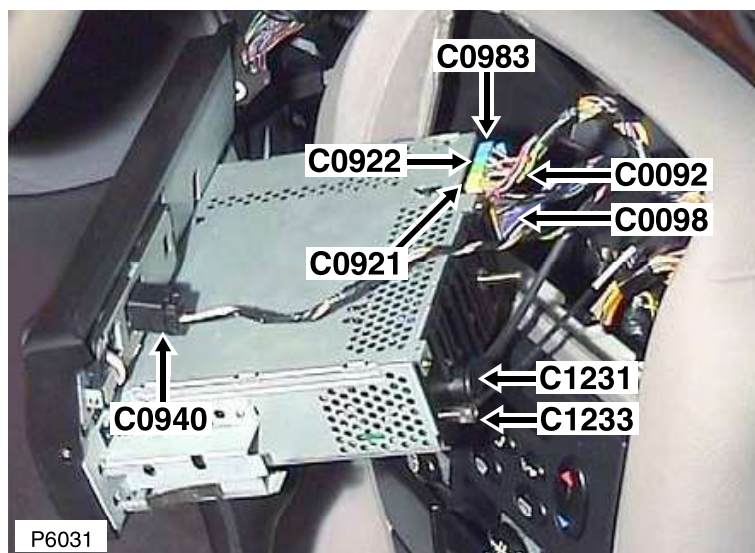

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | 60  |
| 2   | SCR | 60  |

Description: *Cable - Co-axial - Front radio - Diversity*

Location: *Behind radio*

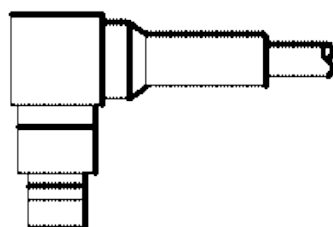


51277142

Colour: *TIN-PLATE*

Gender: *Female*


# C1234

## CONNECTOR DETAILS

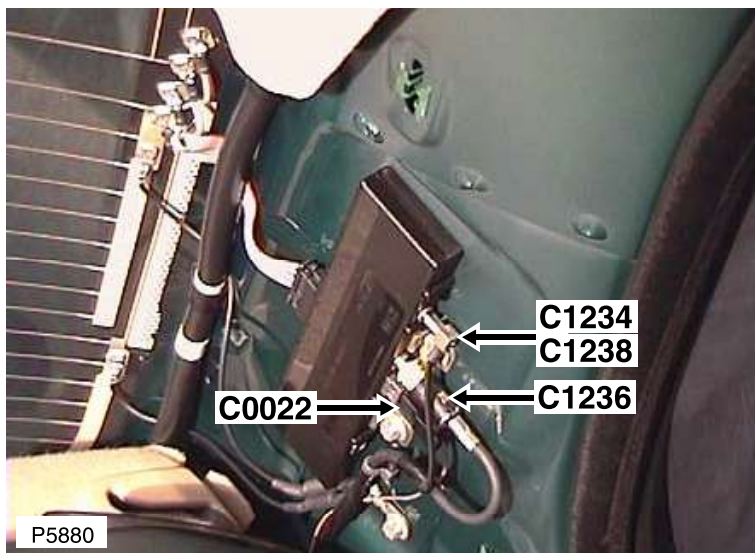


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | 60  |
| 2   | SCR | 60  |

Description: *Cable - Co-axial - Front radio - Diversity*  
 Location: *LH 'D' post*

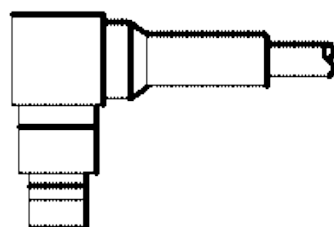

51277143


Colour: *TIN-PLATE*  
 Gender: *Female*

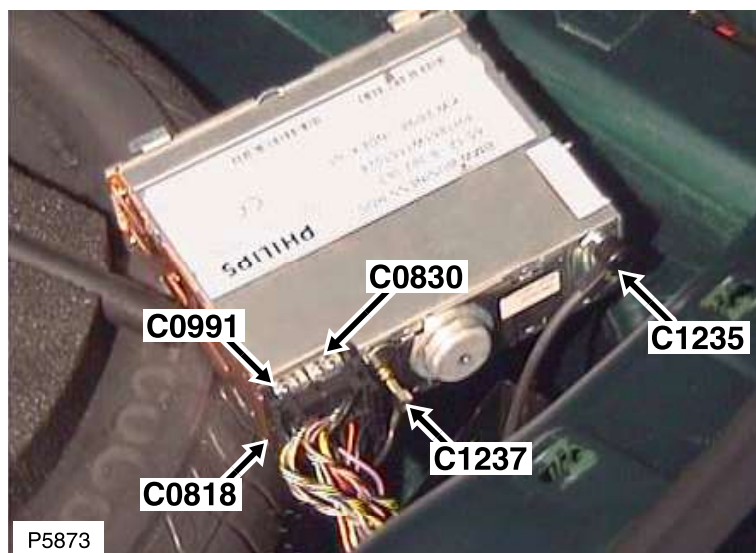

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |

Description: *Cable - Co-axial - Rear radio*


Location: *Rear of luggage compartment - RH side*

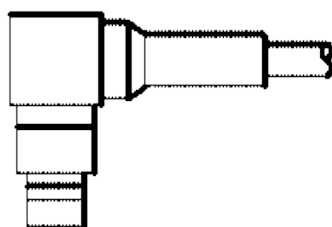

51277143

Colour: *TIN-PLATE*


Gender: *Female*

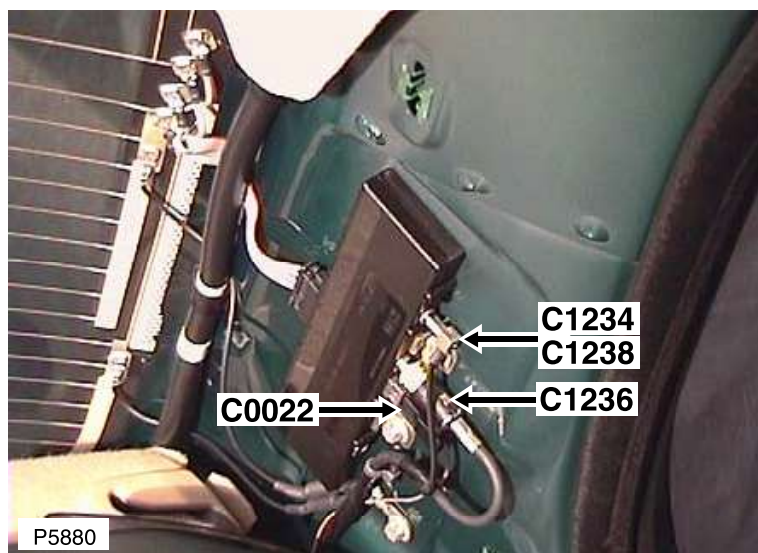

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |

Description: *Co-axial cable*


Location: *LH 'D' post*



0000000000


Colour: *TIN-PLATE*

Gender: *Female*

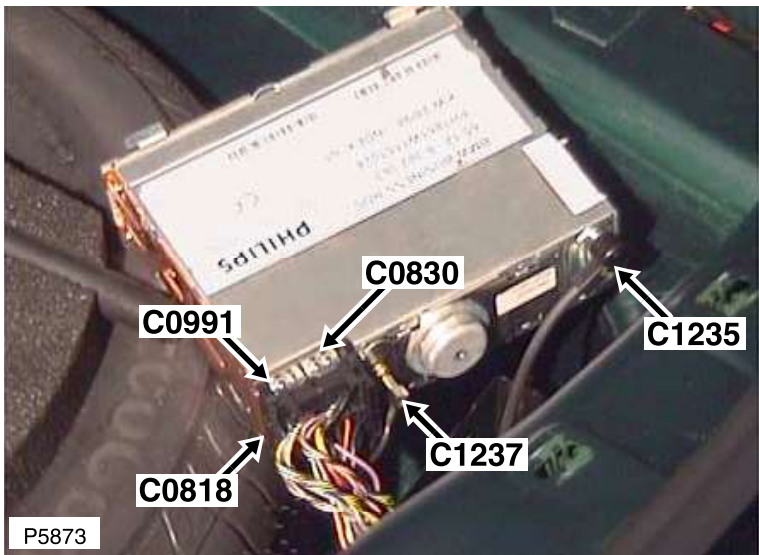

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |

Description: *Cable - Co-axial - Rear radio - Diversity*  
Location: *Rear of luggage compartment - RH side*

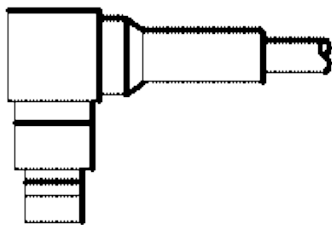


51277143

Colour: *TIN-PLATE*  
Gender: *Female*


# C1238

## CONNECTOR DETAILS

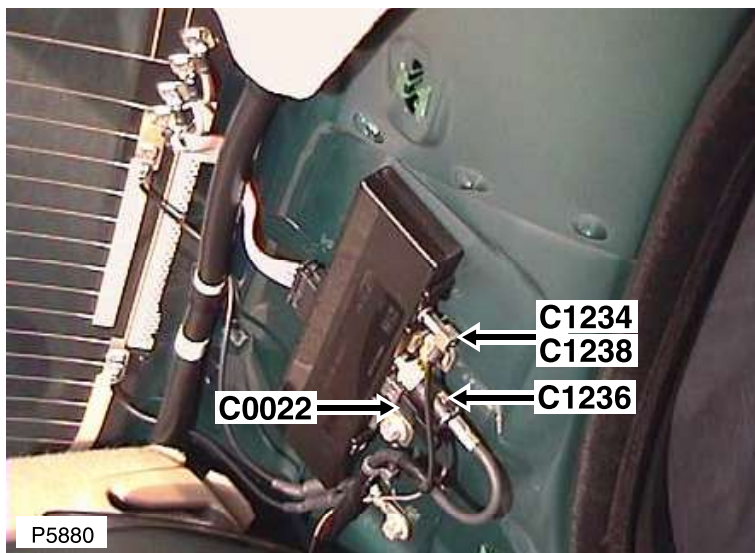

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |


Description: *Cable - Co-axial - Front radio - Diversity*  
 Location: *LH 'D' post*

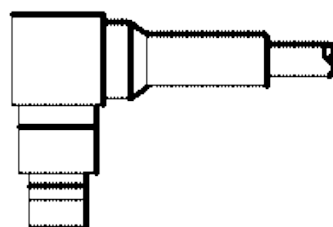

51277146

Colour: *TIN-PLATE*  
 Gender: *Female*




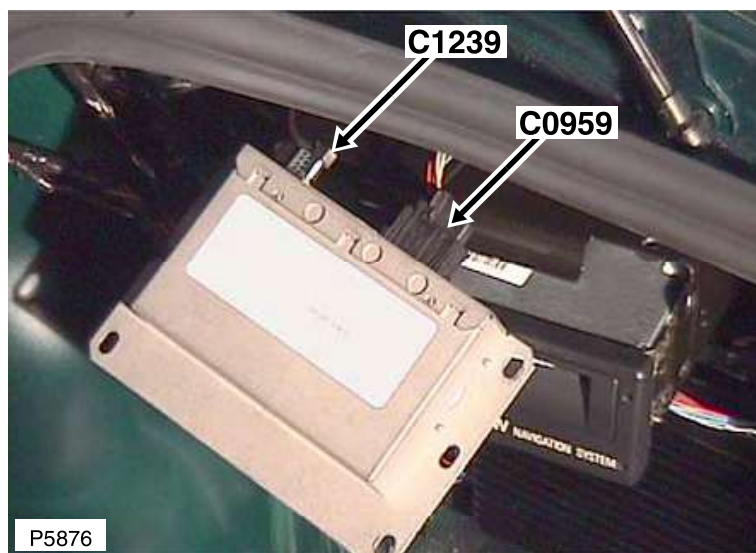

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |

Description: *Cable - Co-axial - Navigation*

Location: *Behind luggage compartment carpet RH side*

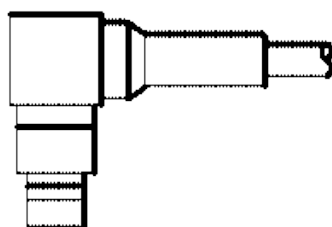


51277146

Colour: *TIN-PLATE*

Gender: *Female*

# C1240


## CONNECTOR DETAILS

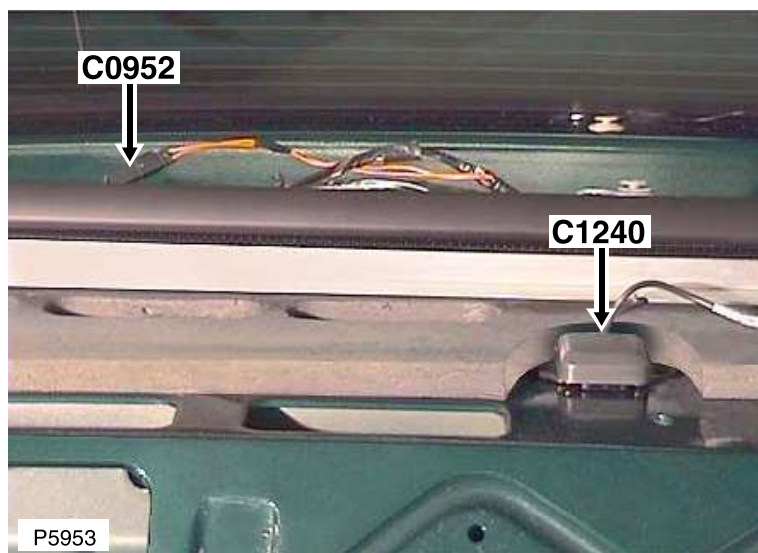

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |

Description: *Cable - Co-axial - Navigation*


Location: *Parcel shelf - under centre*



51277144

Colour: *TIN-PLATE*


Gender: *Female*

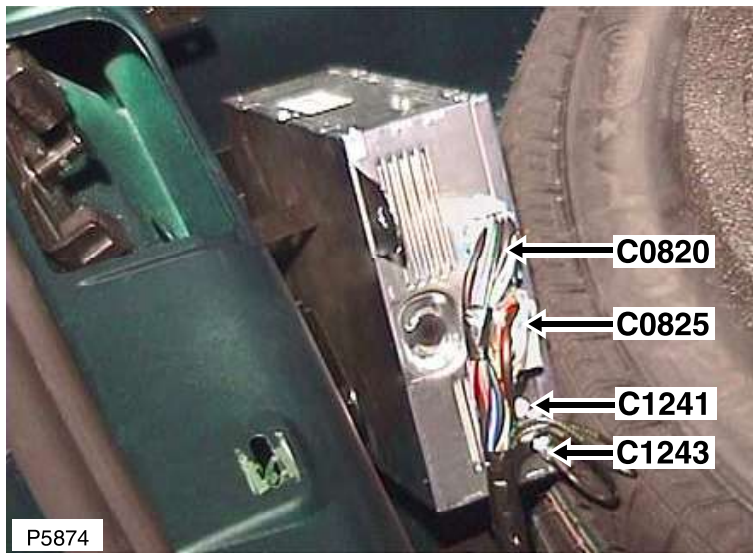

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |

Description: *Cable - Co-axial - Video*


Location: *Rear of luggage compartment - LH side*

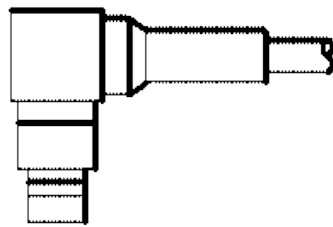

51277146

Colour: *TIN-PLATE*


Gender: *Female*

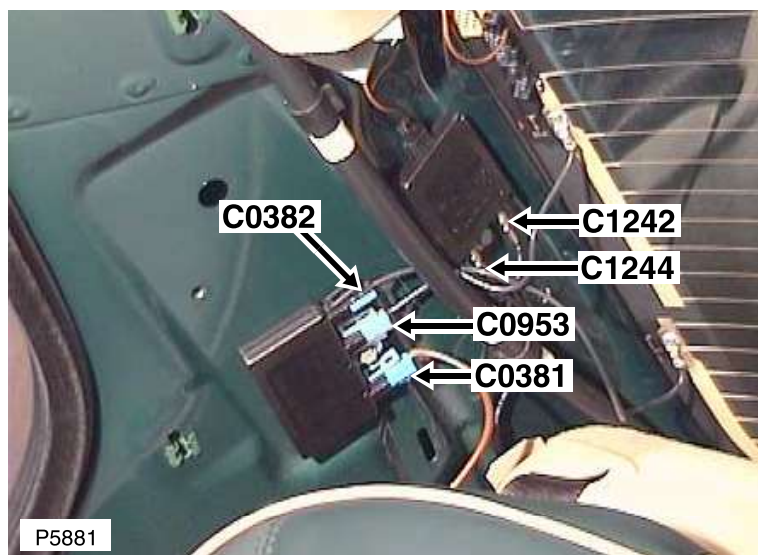

Description: *Cable - Co-axial - Video*

Location: *RH 'D' post*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |



51277147

Colour: *TIN-PLATE*


Gender: *Female*

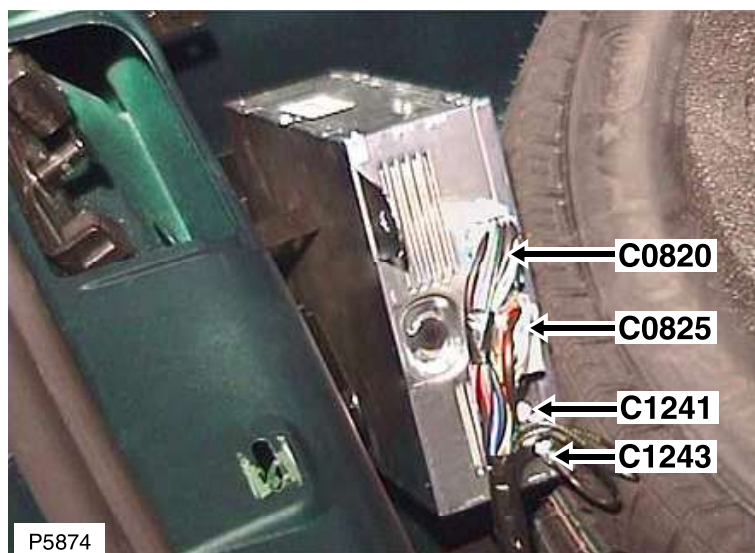

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |


Description: *Cable - Co-axial - Video*

Location: *Rear of luggage compartment - LH side*

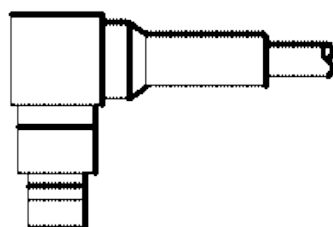

Colour: *TIN-PLATE*


Gender: *Female*

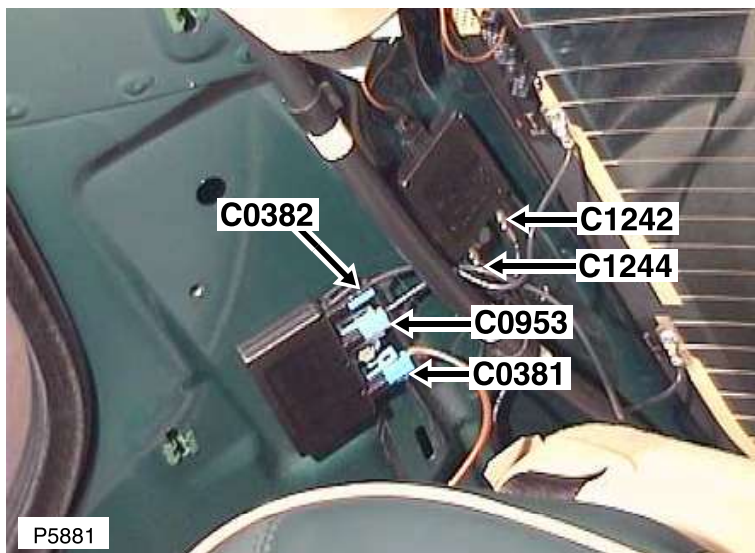

Description: *Cable - Co-axial - Video*

Location: *RH 'D' post*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |



51277147


Colour: *TIN-PLATE*

Gender: *Female*



| Cav | Col | Cct |
|-----|-----|-----|
| 1   | LGW | ALL |
| 2   | UO  | ALL |
| 3   | WRY | ALL |
| 5   | UP  | ALL |
| 6   | B   | ALL |

Description: *Interface - K BUS*  
Location: *Behind centre console*

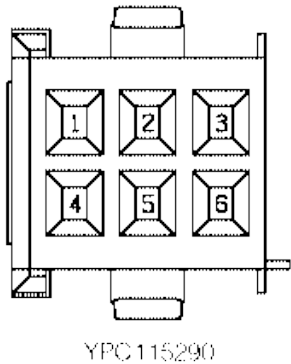


Colour: *BLACK*  
Gender: *Female*



# C1301


## CONNECTOR DETAILS

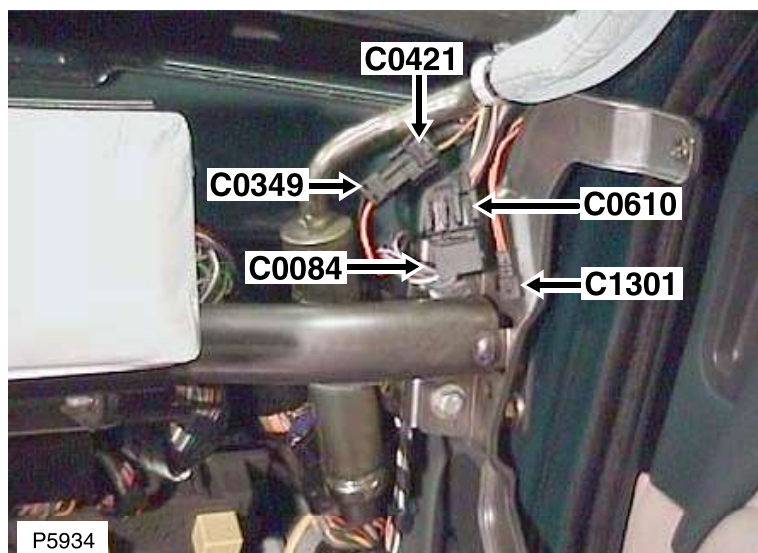

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | O   | ALL |
| 2   | OB  | ALL |

Description: *Roof harness to phone harness*


Location: *Behind RH side of fascia*

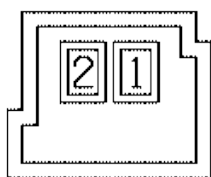

YPC115750

Colour: *BLACK*


Gender: *Male*

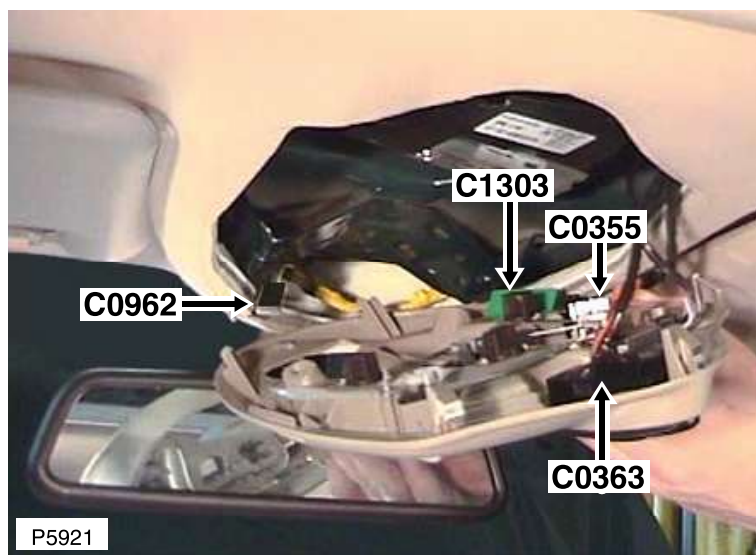

Description: *Microphone - Telephone*

Location: *Behind interior light*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | OB  | ALL |
| 2   | O   | ALL |

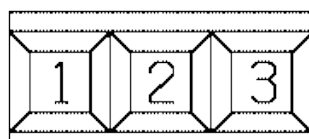


YPC117800

Colour: *BLACK*

Gender: *Female*

# C1304


## CONNECTOR DETAILS

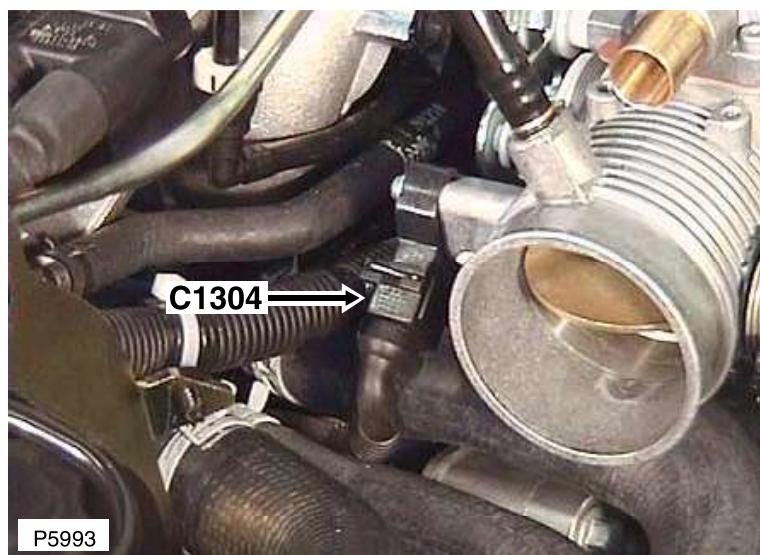

Description: *Sensor - Traction control - KV6*

Location: *Above gearbox*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | G   | ALL |
| 2   | K   | ALL |
| 3   | S   | ALL |

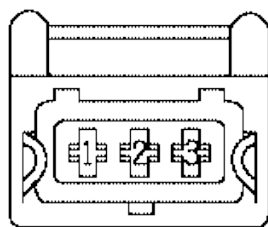

YPC 114930


Colour: *BLACK*

Gender: *Female*

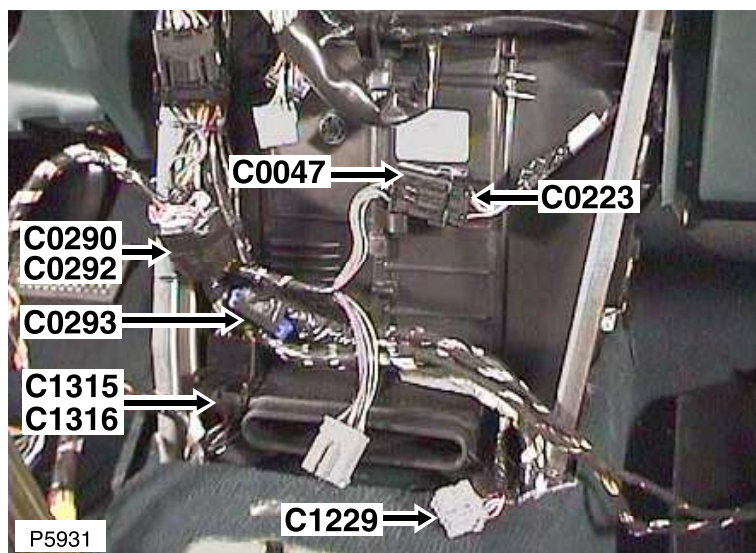

Description: *Radio / cassette player*

Location: *Behind front of centre console*

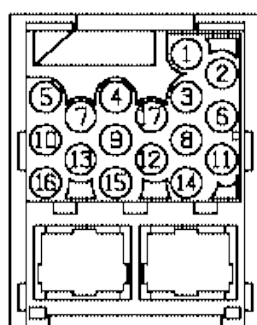


YPC115120

Colour: *BLACK*


Gender: *Female*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | BW  | 23  |
| 2   | BP  | 23  |
| 3   | BN  | 23  |
| 5   | LGW | 23  |
| 6   | BG  | 23  |
| 7   | WRY | 23  |
| 8   | BS  | 23  |
| 9   | PK  | 23  |
| 10  | UO  | 23  |
| 11  | BU  | 23  |
| 12  | BR  | 23  |
| 13  | RW  | 23  |
| 14  | BO  | 23  |
| 15  | B   | 23  |
| 16  | PY  | 23  |
| 17  | UP  | 23  |

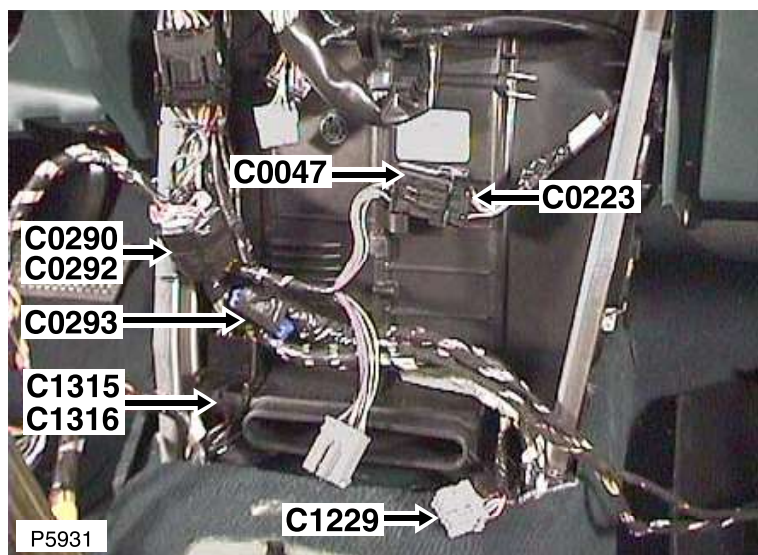


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | KB  | 23  |
| 2   | YB  | 23  |
| 6   | BK  | 23  |
| 7   | BY  | 23  |

Description: *Radio / cassette player*  
Location: *Behind front of centre console*

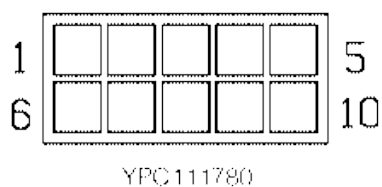


Colour: *BLACK*  
Gender: *Female*

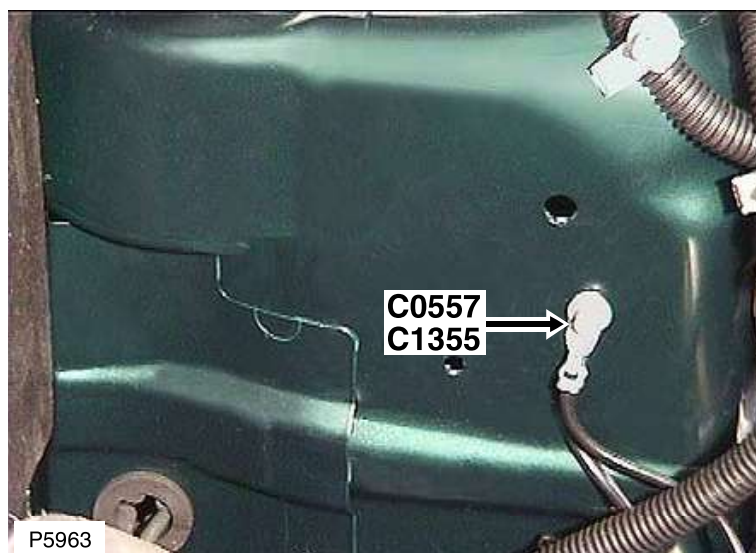

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |

Description: *Earth*

Location: *Under bonnet, LH inner wing*

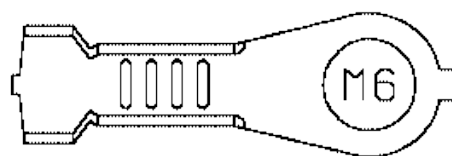

YPG10013


Colour: *TIN-PLATE*

Gender: *Eyelet*



# C1516


## CONNECTOR DETAILS

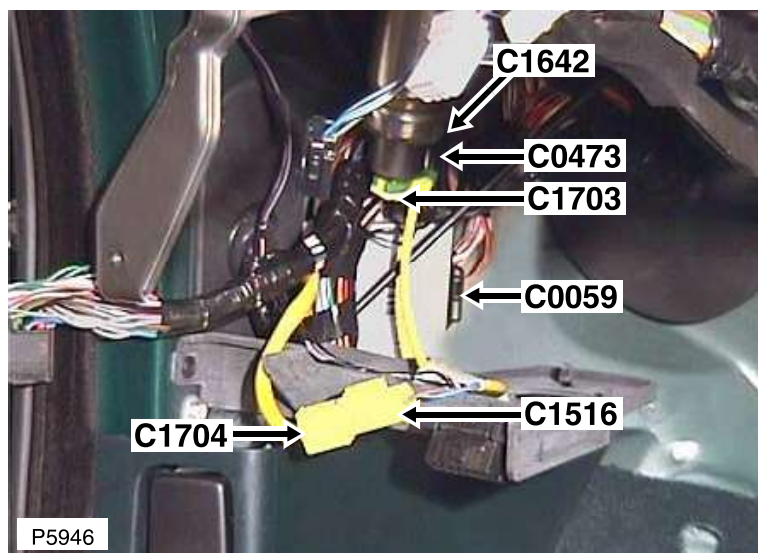

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | Y   | ALL |
| 2   | R   | ALL |

Description: *Main harness to SRS harness*


Location: *Behind LH side of fascia*

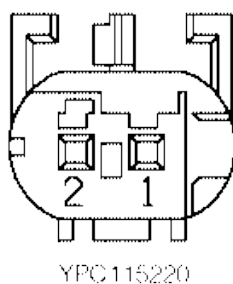

Colour: *YELLOW*

Gender: *Male*




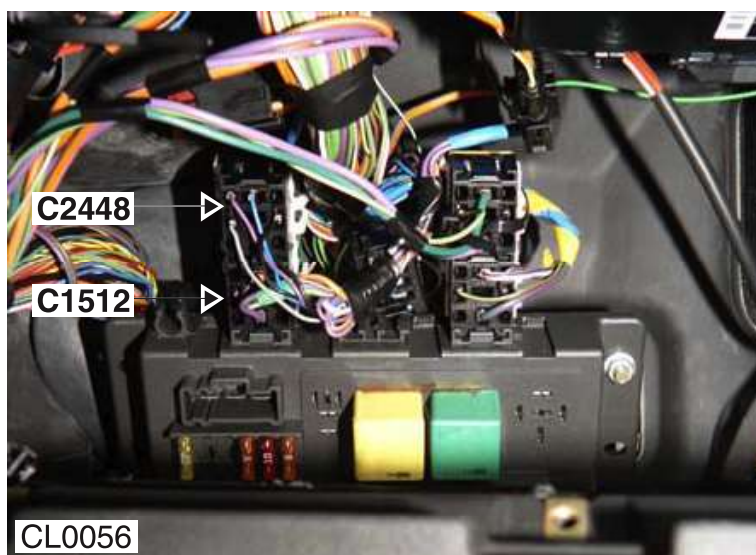

| Cav | Col | Cct |
|-----|-----|-----|
| 2   | OR  | ALL |
| 4   | U   | ALL |
| 5   | LGW | ALL |
| 6   | BY  | ALL |
| 8   | P   | ALL |


Description: *Relay - FBH*

Location: *Behind Glovebox*

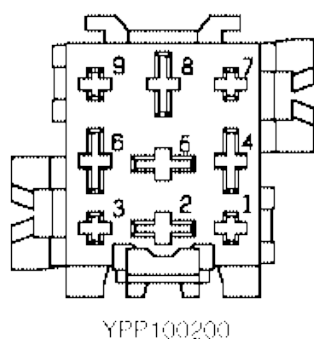


Colour: *BLACK*

Gender: *Female*

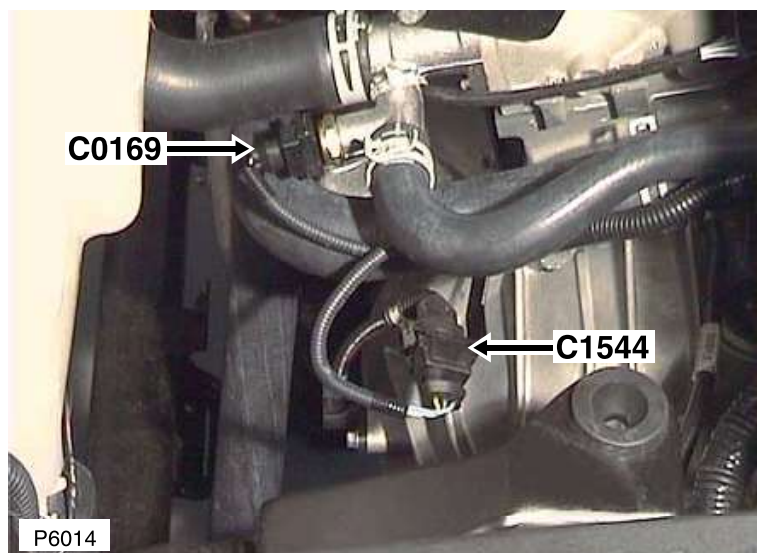

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | YU  | ALL |
| 2   | UP  | ALL |
| 3   | WU  | ALL |

Description: *Sensor - Crankshaft position (CKP) - K1.8*  
Location: *Front of engine - centre*

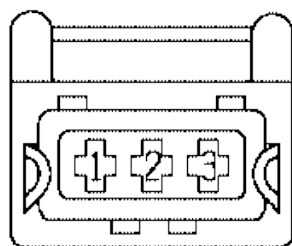

YPC114950

Colour: *BLACK*  
Gender: *Female*



Description: *Sensor - Pressure - Fuel rail - M47R*


Location: *Rear of engine compartment*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | NG  | ALL |
| 2   | UB  | ALL |
| 3   | WY  | ALL |

**NO CONNECTOR FACE**

Colour: *BLACK*

Gender: *Female*

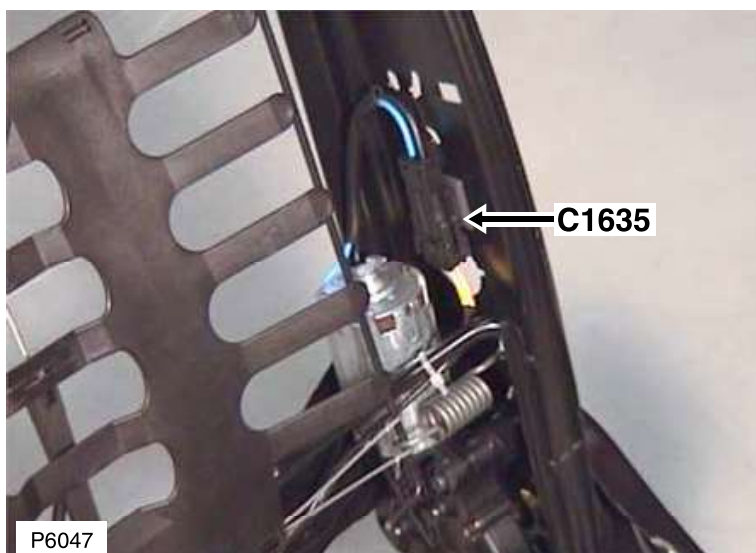

Description: *Motor - Seat - Back recline - RH*

Location: *Under front seat squab cover*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | KY  | 14  |
| 2   | KU  | 14  |
| 3   | RG  | 14  |
| 4   | BG  | 14  |
| 5   | YK  | 14  |



YPC112330

Colour: *BLACK*

Gender: *Female*

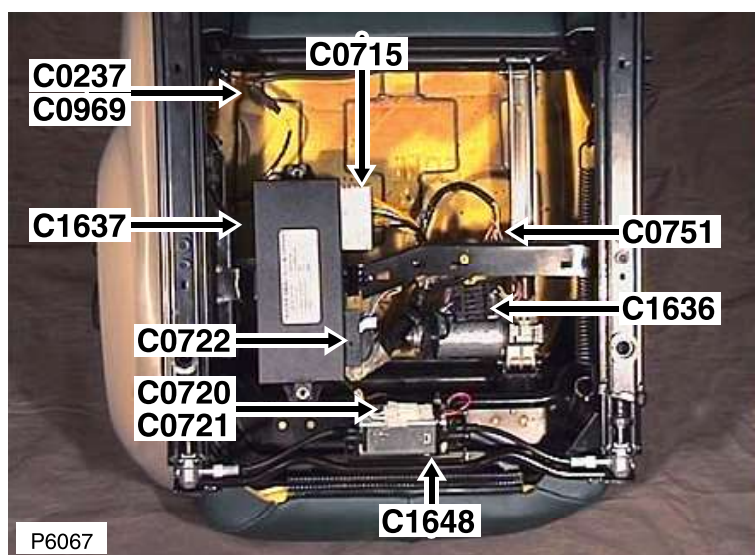

Description: *Motor - Seat rear - Up / down*

Location: *Beneath driver's seat*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | YS  | 14  |
| 2   | KS  | 14  |
| 3   | RG  | 14  |
| 4   | BG  | 14  |
| 5   | SY  | 14  |



YPC112330

Colour: *BLACK*


Gender: *Female*

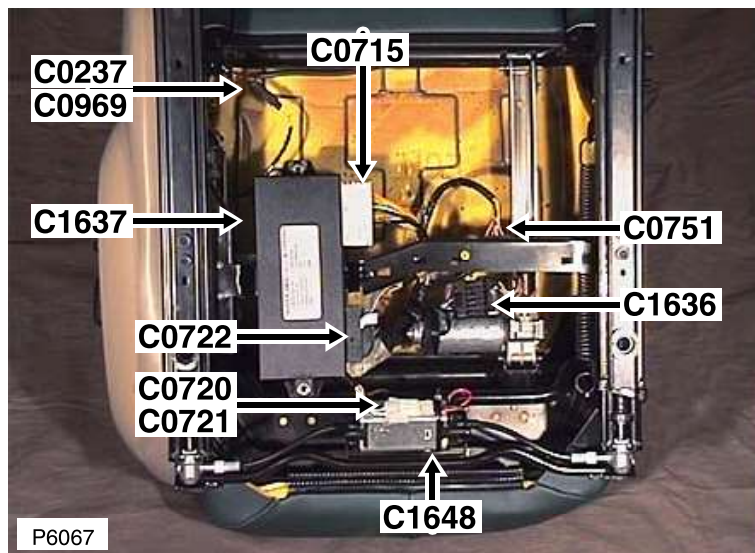

Description: *Motor - Seat front - Up / down*

Location: *Beneath driver's seat*


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | NY  | 14  |
| 2   | KY  | 14  |
| 3   | RG  | 14  |
| 4   | BG  | 14  |
| 5   | YN  | 14  |

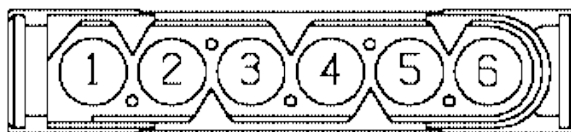

YPC112330

Colour: *BLACK*


Gender: *Female*

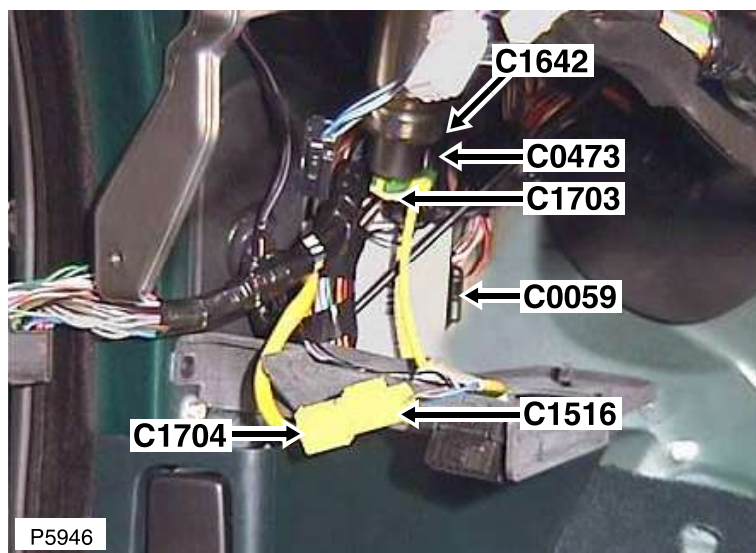

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | OS  | ALL |

Description: *Main harness to trailer harness*

Location: *Behind LH side of fascia*

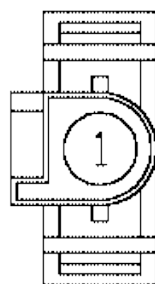

YPC113890


Colour: *BLACK*

Gender: *Female*



# C1648

## CONNECTOR DETAILS

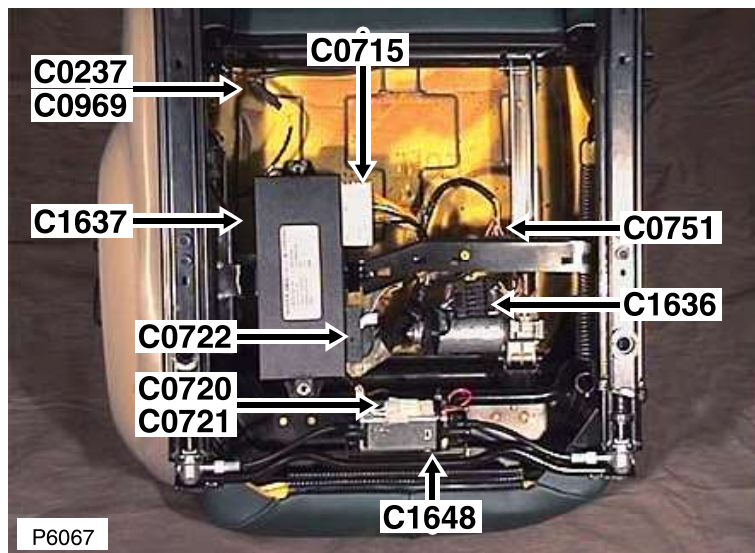


| Cav | Col | Cct |
|-----|-----|-----|
| 1   | RG  | 14  |
| 2   | KG  | 14  |
| 3   | BG  | 14  |

Description: *Sensor - Hall effect*  
Location: *Beneath driver's seat*

**NO CONNECTOR FACE**

Colour: *NATURAL*  
Gender: *Female*

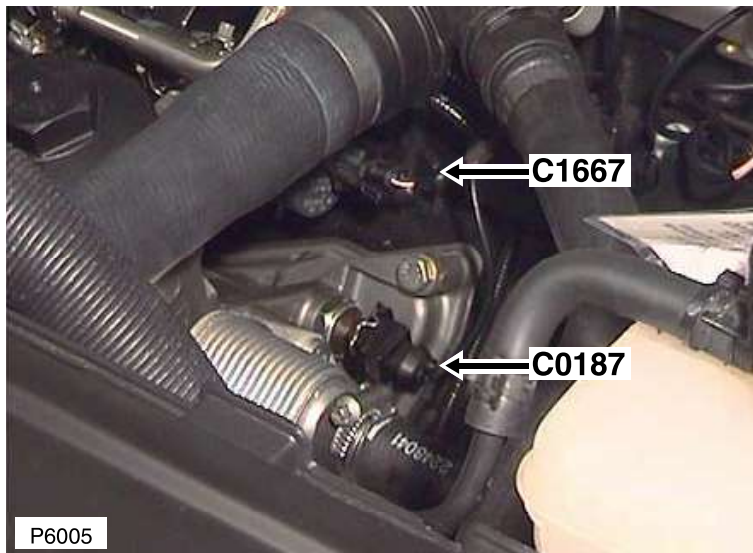

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | RW  | ALL |
| 2   | NU  | ALL |


Description: *Regulator - Fuel pressure - M47R*

Location: *Front of engine - centre*

**NO CONNECTOR FACE**

Colour: *BLACK*


Gender: *Female*

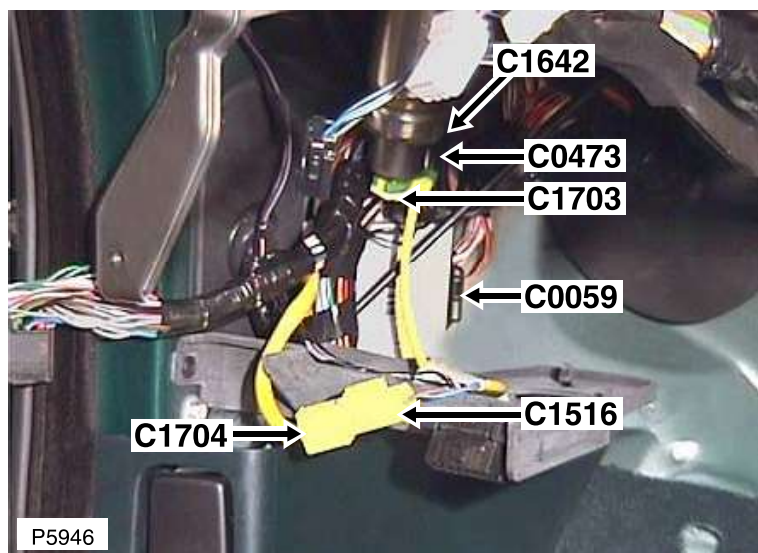

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | Y   | ALL |
| 2   | R   | ALL |

Description: *Air bag - Head*


Location: *Behind LH side of fascia*

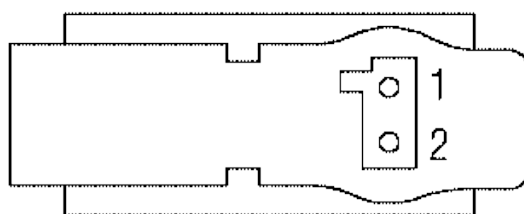

51277098

Colour: *GREEN*


Gender: *Female*

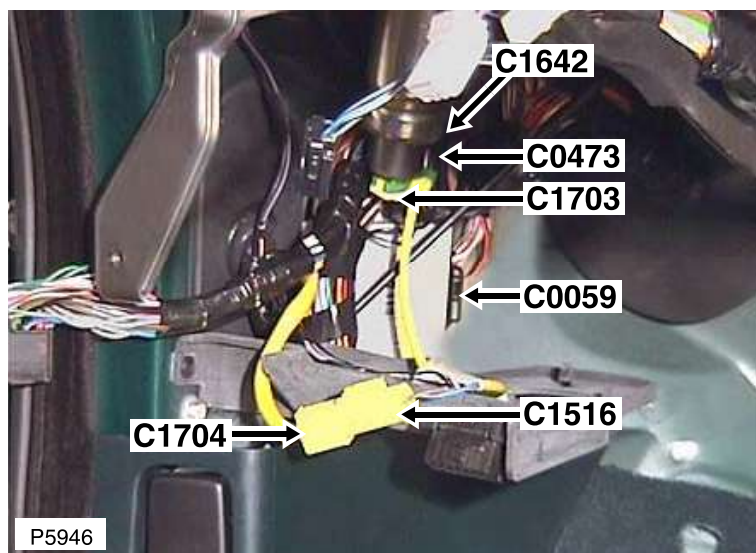

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | WN  | 48  |
| 2   | WK  | 48  |

Description: *Main harness to SRS harness*


Location: *Behind LH side of fascia*

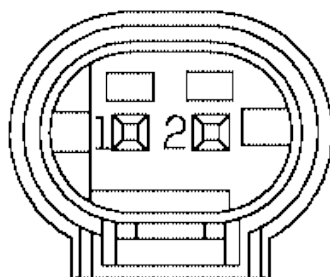

YPC116050

Colour: *YELLOW*

Gender: *Female*

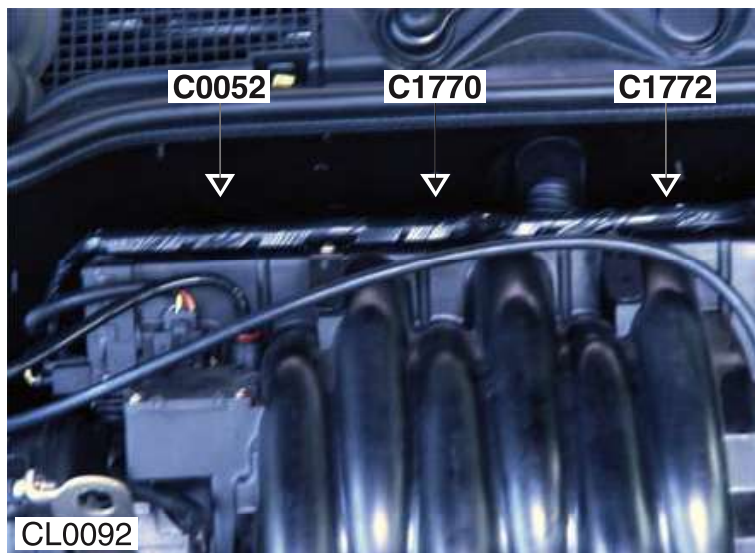


Description: *Ignition coil - 4 - KV6 - Plug top coil*  
Location: *Top rear of engine - centre*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | NK  | ALL |
| 2   | B   | ALL |
| 3   | BY  | ALL |

**NO CONNECTOR FACE**

Colour: *BLACK*  
Gender: *Female*

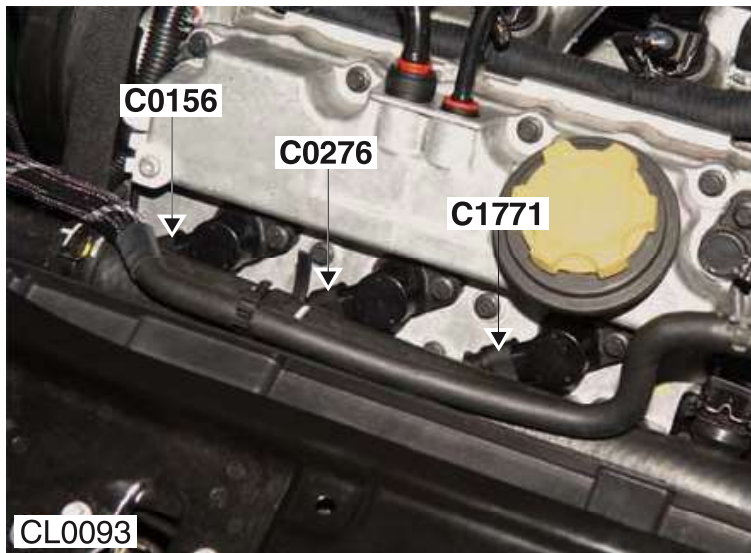

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | NK  | ALL |
| 2   | B   | ALL |
| 3   | BP  | ALL |


Description: *Ignition coil - 5 - KV6 - Plug top coil*

Location: *Top front of engine - right*

**NO CONNECTOR FACE**

Colour: *BLACK*

Gender: *Female*

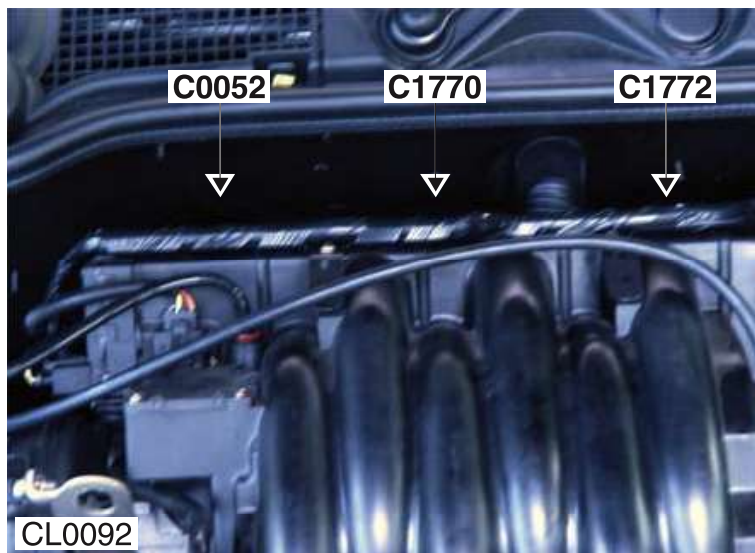

Description: *Ignition coil - 6 - KV6 - Plug top coil*  
Location: *Top rear of engine - right*

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | NK  | ALL |
| 2   | B   | ALL |
| 3   | BU  | ALL |

**NO CONNECTOR FACE**

Colour: *BLACK*  
Gender: *Female*





| Cav | Col | Cct |
|-----|-----|-----|
| -   | -   | -   |
| -   | -   | -   |


Description: *Timer - FBH*

Location: *Inside cubby box*



Colour: *BLACK*

Gender: *Female*

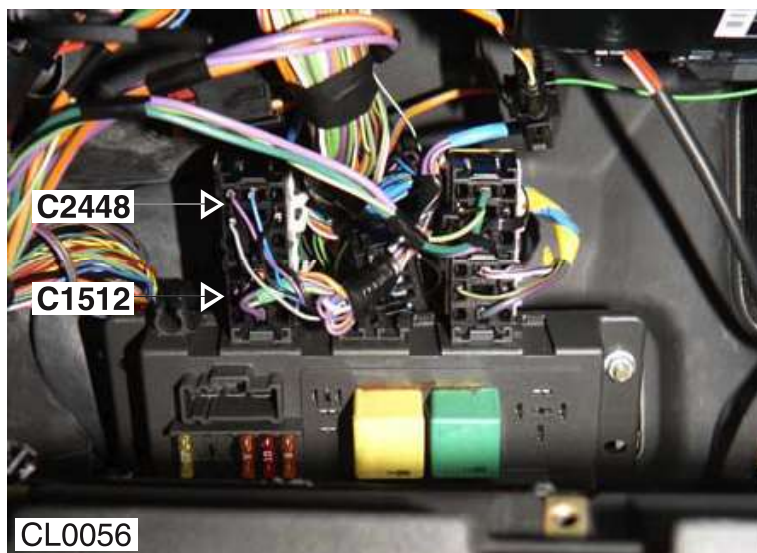

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | S   | ALL |
| 3   | B   | ALL |
| 4   | J   | ALL |
| 6   | P   | ALL |


Description: *Receiver - FBH*

Location: *Behind Glovebox*

**NO CONNECTOR FACE**

Colour: *BLACK*


Gender: *Female*

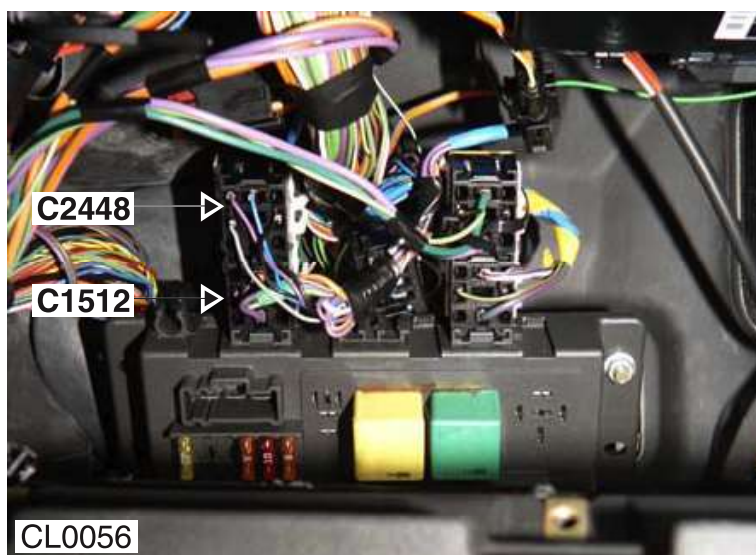

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | P   | ALL |
| 2   | U   | ALL |
| 4   | S   | ALL |
| 6   | B   | ALL |
| 8   | B   | ALL |

Description: *Relay - FBH*

Location: *Behind Glovebox*

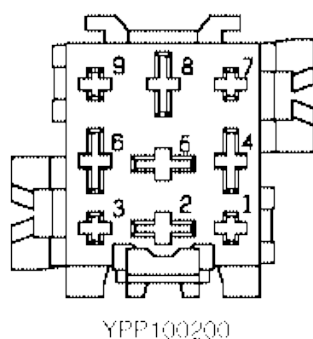

Colour: *BLACK*

Gender: *Female*



| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |


Description: *Receiver - FBH*

Location: *Behind front bumper*

**NO CONNECTOR FACE**

Colour: -


Gender: -

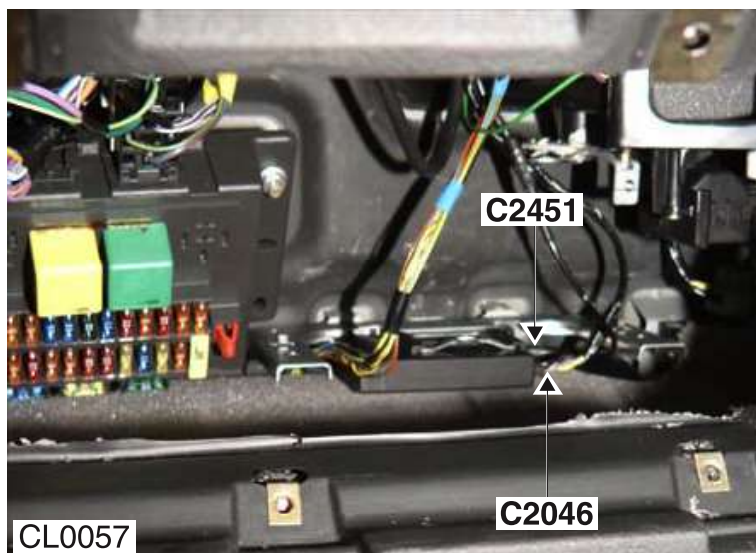

| Cav | Col | Cct |
|-----|-----|-----|
| 1   | B   | ALL |
| 2   | SCR | ALL |

Description: *Receiver - FBH*

Location: *Behind Glovebox*

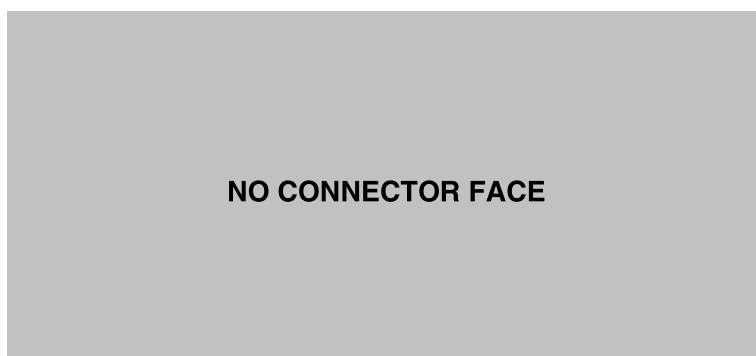

Colour: *BLACK*

Gender: *Male*